# THE TEXT IS FLY WITHIN THE BOOK ONLY

# THEORY OF MEASUREMENTS

# A MANUAL FOR PHYSICS STUDENTS

CARNEGIE ASTIBUTE OF TECHNIC JAMES B FRENENS Professor of Physics in the University States PITTS BUILDH,

ILLUSTRATED

SECOND EDITION, REVISED



NEW YORK

D. VAN NOSTRAND COMPANY

25 PARK PLACE

1917

COPYRIGHT 1915, 1917,

BY

D. VAN NOSTRAND COMPANY

#### PREFACE

This book is designed to be used in either of two ways:

- 1. As a Text-book. The work outlined would require two semester hours for its completion. By extending the discussions and problems, it may be made to cover three semester hours; or by omitting portions of the theory, the student may gain a working knowledge of the subject in a shorter time. A "rule of thumb" knowledge of adjusting observations, however, is not to be recommended.
- 2. As a Laboratory Guide. The work would cover a three years' course in the physical laboratory. During the first year, the student would make use of those portions which are devoted to methods of estimating precision, and the propagation of errors; in the second year the methods of adjustment of observations would be used; and in the third year the student should be prepared to discuss his results by the use of empirical formulae and curves. The work of the second year is well adapted to students in junior courses in engineering, the adjustment of data obtained from surveys being especially appropriate.

The use of the graphic method would be illustrated throughout the entire course.

Considerable space is devoted to the theory of probability. This subject is a fascinating one to students, presumably on account of its human interest.

J. S. S.

University of Maine, Orono, Me., January, 1915.

# CONTENTS

PREFACE. iii NOTATION. vii
CHAPTER I
Introduction         1           Measurements         2           Errors         3
CHAPTER II
PROBABILITY.         4           THE CURVE.         9           THE INTEGRAL.         14           THE ARITHMETICAL MEAN         17           A CONSTANT INTERVAL         17           WEIGHTS.         18
CHAPTER III
THE ADJUSTMENT OF OBSERVATIONS.         22           SHORT METHODS.         32           ILLUSTRATIONS.         32
CHAPTER IV
THE PRECISION OF MEASUREMENTS

#### CONTENTS

	PAGE
PRECISION MEASURES AND THEIR DERIVATION	. 37
Average Deviation	. 38
PROBABLE ERROR	
I NODEDIN LINION	
CHAPTER V	
THE PROPAGATION OF ERRORS	44
THE DIRECT PROBLEM	
	49
Fractional Method	50
BEST MAGNITUDES AND RATIOS	
DEST WAGNITUDES AND IMATOS	. 01
CHAPTER VI	
_	
PLOTTING	
METHOD ILLUSTRATED	55
Construction and Interpretation of Curves	
Application to Laboratory Problems	<b>57</b>
CHAPTER VII	
CHAFIER VII	
Negligibility	62
Applications	. 63
Criteria	. 66
SIGNIFICANT FIGURES	
	00
CHADMED THE	
CHAPTER VIII	
EMPIRICAL FORMULAE AND CONSTANTS	. 72
METHOD OF PROCEDURE	. 72
Types of Curves	
ILLUSTRATIONS	

#### NOTATION

The following notation will be used in this book:

```
y = Simple probability;
```

P=Compound probability;

Q =Negative probability;

m =Single observation;

M =Mean of observations;

z=True value of a component observation;

Z = The resultant true value;

x = Error;

v = Residual;

h =Measure of precision;

k = Probability of error zero;

r=Probable error of a single observation;

 $r_0$ =Probable error of the mean;

 $\delta$ =Error in a component measurement;

 $\Delta$ =Error in a result;

a.d. = Average deviation of a single observation;

A.D. = Average deviation of the mean;

p = Weight (Latin pondus);

E = Huge error.

## THEORY OF MEASUREMENTS

#### CHAPTER I

#### INTRODUCTION

Lord Kelvin has told us that one's knowledge of science begins when he can measure what he is speaking about and express it in numbers. Every year a vast number of measurements are made in physical, chemical, and engineering laboratories, as well as in laboratories for advanced research. We are unable, however, to state concerning any one of these measurements that the result is absolutely correct. One of the most precise measurements in physical science is that of the wave-length of light. The wave-length of cadmium light, measured by a Michelson interferometer and a Rowland grating, was found to be

 $\lambda_c = 0.000064384722$  cm. (Michelson)  $\lambda_c = 0.00006438680$  cm. (Rowland).

Or we may put it in another way,

- 1 meter contains 1553163.6 wave-lengths (Michelson),
- 1 meter contains 1553164.1 wave-lengths (Fabry and Perot).

These measurements were made by different observers using different methods. They are remarkable for their agreement and they give us the wave-length of light with sufficient accuracy for all purposes. But they are not correct, and it is not at all likely that we shall ever know the true length of a wave of cadmium light.

It is of great importance, however, that we should be able to pass judgment upon the accuracy of measurements like these. To borrow another illustration from the domain of optics, we may assume the value for the velocity of light to be 299860±30 km. per second. Here the number 30 is a measure of precision, which, if omitted, would make the statement ridiculous, since the velocity of light has not been measured with sufficient accuracy to be regarded as correct to a single kilometer.

A student who brings in a value for g, resulting from measurements with a simple pendulum, of 982.436 centimeters per second per second, is likely to look upon the result with complacency until he is made to see that all figures after the 8 are useless because erroneous.

#### MEASUREMENTS

Measurements are usually classified as follows:

- 1. Direct—when, for example, a distance is measured with a tape line.
- 2. Indirect—when, for example, the density of a cylinder is determined by measurements of its length, diameter, and mass.
- 3. Conditioned—when, for example, the third angle of a triangle is restricted by the values of the other two angles.

Measurements not so conditioned are called independent.

#### ERRORS

Errors in measurement may be divided into two general classes:

1. Those which may be eliminated, in part at least, by improving adjustments and taking greater care in the method employed.

These include errors in instruments, such, for example, as are caused by faulty measuring sticks, imperfectly graduated circles, and poorly adjusted balance beams. The obvious method of correcting these errors is to substitute good instruments for poor ones; or, when possible, to eliminate the errors by compensation.

Personal Errors. These are errors characteristic of the individual observer. If we swing a pendulum before a class of students and ask them to indicate the times of greatest displacement by tapping with their pencils, the result will well illustrate the personal equation. In the experiment in wireless telegraphy by which time messages were sent from Paris to Arlington, each observer was carefully rated in order that this error should be guarded against.

Mistakes are, unfortunately, too common in students' laboratory work to call for an extended explanation. Errors in reading scales, in computation, and in tabulation may be classed as mistakes, and these should become less and less frequent as the student gains experience.

2. The second class consists of errors which are indeterminate in their nature, and may not be entirely eliminated, however much care we may take in our measurements, or by the use of the highest grade of apparatus. It is these errors with which we are concerned in the discussions in this book.

#### CHAPTER II

#### PROBABILITY

Professor Jevons in his *Principles of Science* states a truism which has an important bearing upon the theory of probability. "Perfect knowledge alone can give certainty, and in Nature perfect knowledge would be infinite knowledge, which is clearly beyond our capacities. We have, therefore, to content ourselves with partial knowledge—knowledge mingled with ignorance producing doubt."

We may interpret this to mean that from the point of view of Omniscience everything exists as certainty. The path of a leaf falling from a tree, as well as that of a mote dancing in a sunbeam is known with as great a certainty as that of a heavy body dropped to the earth. For finite minds, however, where certainty is impossible, the ability to pass upon the probability that an event will happen in a certain way is the best substitute attainable.

What is highly probable in minds of a certain order of intelligence, may be improbable to others. To a trained meteorological observer, it may appear extremely probable that it will rain to-morrow; to one who bases his weather predictions upon popular superstition, it may be improbable. Again it may seem probable to certain people that spirit hands produced music at a séance, while to others the probability becomes negative.

We may look at the subject in another way. When a championship game of baseball has been finished, the result becomes a certainty in the minds of the spectators; while in various parts of the country, where the result has not as yet been reported, bets continue to be made expressing the probability of what to other minds is a certainty.

If a coin is tossed up under normal conditions, the probability that it will fall "heads" is one out of two, or one-half. This is also the probability that it will fall "tails." We have, then, from our notation,  $y=\frac{1}{2}$ , or, since we shall deal with more than one event,  $P=\frac{1}{2}$  and  $Q=\frac{1}{2}$ . Since the coin must fall in one way or the other, we have

$$P+Q=1$$
 (the symbol for certainty).

If n coins are thrown, we have, by the binomial theorem

$$(P+Q)^n = P^n + nP^{n-1}Q + \frac{n(n-1)}{2}P^{n-2}Q^2 + \dots$$

The first term expresses the probability that all will come down heads, the second that all but one will come down heads, etc.

If we take n=6, the chances that all will be heads may be expressed by the fraction  $\frac{1}{64}$ , and that five will be heads by  $\frac{6}{64}$ .

#### **PROBLEMS**

1. By expanding the binomial to the proper number of terms, show that the chances for four, three, two, one, and no heads may be expressed by  $\frac{15}{64}$ ,  $\frac{20}{64}$ ,  $\frac{1}{64}$ ,  $\frac{6}{64}$ , and  $\frac{1}{64}$ .

- 2. By using an additional term prove that it is impossible to throw seven heads with six coins.
- 3. Plot a curve with the data obtained, and preserve it for future use.
- 4. If the class is sufficiently large (say 20) it will prove an interesting exercise to take the mean results of 64 trials by each student and compare with the results obtained by theory.

A better acquaintance with the laws of probability may be obtained by putting aside the formula and solving the following problems by an appeal to reason.

#### **PROBLEMS**

- 1. If two dice are thrown what is the probability that the sum of the numbers will be five? We first determine the possible results with two dice, which may be obtained by considering that each number on one die may appear with each number on the other. This gives us  $6\times 6=36$ . Five may be obtained either by a four and a one, or a two and a three. Now the four may be on the first die and the one on the second, or the one may be on the first and the four on the second. The same is true for the two and three. Thus we have four possibilities, giving a probability of  $\frac{3}{36}$ .
- 2. What is the probability of throwing one ace with a single die in one throw?
- 3. What is the probability of throwing no ace with a single die in one throw?
- 4. What is the probability of throwing one ace in two trials?

- 5. What is the probability of throwing two aces in two trials?
- 6. What is the probability of throwing no ace in two trials?
- 7. What is the probability of throwing only one ace in two trials?
- 8. A bag contains eight red, six black, and five green balls. What is the probability of drawing first a red and then a black ball in two trials?
- 9. The class record shows that each student in a class of twenty-five usually solves one problem out of three assigned. What is the probability that an assigned problem will be solved?
- 10. In Merriman's Least Squares we have this problem: Let a hundred coins be thrown up each second by each of the inhabitants of the earth. How often will a hundred heads be thrown in a million years? (It will prove interesting for the student to guess the answer to this problem before solving it. The number of inhabitants may be taken as one and one-half billion.)

Before leaving the subject of probability a few general considerations may be suggested. It is a rather prevalent notion that antecedent happenings have an effect upon present probability. If a coin has come down heads five times in succession, it is pretty difficult to convince the average man that the chances for tails on the sixth throw are not greater than the chances for heads. Of course, if the conditions are normal, the probability of throwing heads is just one-half. (The derivation of the word chance is an interesting one.) Such expressions as "the turning

of luck" indicate the strong hold this feeling has upon the majority of people.

Again, we should not become over-confident from the results of the laws of probability. Interesting applications may be found in connection with the periodic law of Mendeleéff; the law of Prout, which states that the atomic weights of the other elements are exact multiples of that of hydrogen; and the kinetic theory of gases as developed by Clausius and Mayer. A case in which the probability almost becomes a certainty is illustrated by the coincidence of the seventy spectral lines in iron vapor with those in solar light. The possible arrangement of the seventy lines would be

$$70\times69\times68\times\ldots$$
  $4\times3\times2\times1$ .

But as all possible arrangements would not apply, the probability of a chance coincidence has been estimated by Kirchhoff as one in one trillion. Do we know that iron exists in the sun?

The following illustration may serve to weaken our feeling of certainty: Imagine a fly watching two coincidence pendulums which come together on the eighty-first swing. While we are about it, let us imagine that in the mind of a fly, one second represents a year. The fly will watch the vibrations for ten seconds (years) and report to another fly which has just come up, that quite an extended series of observations fails to discover the two pendulums in coincidence. The pendulums are watched through fifty, sixty, and seventy swings and it becomes a

law in flyland that pendulums do not get together. When the law has become established by observations extending over eighty fly-years, the bell rings and the assumption based upon a very reasonable law of probability breaks down.

The Probability Curve. Referring to problem 3, page 6, it will be seen that the curve takes the form indicated in Fig. 1.

Any similar data from experiments which follow the laws of probability would yield such a curve as this.

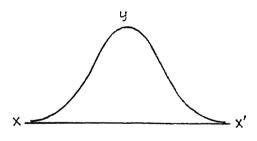


Fig. 1.

A familiar illustration is afforded by target practice. If the target is marked off into divisions, the distances of these divisions from the center may be taken to represent the magnitude of the errors. If a series of shots be fired by expert marksmen under normal conditions, they will form the basis for a curve which will resemble Fig. 1.

Since the errors are plotted along the x-axis and their corresponding probabilities along the y-axis; and since the curve is seen to be symmetrical with respect to the

y-axis, and the x-axis is an asymtote, it will be seen that its equation must take some such form as

$$y = e^{-x^2}$$
.

A rigid deduction of this probability equation has been given by Gauss.

Let x represent an error and y its probability. Then

$$y_1 = f(x_1), \quad y_2 = f(x_2), \quad \dots \quad y_n = f(x_n). \quad \dots \quad (1)$$

For compound probability

$$P = y_1 y_2 \dots y_n = f(x_1) f(x_2) \dots f(x_n); \qquad (2)$$

$$\log P = \log f(x_1) + \log f(x_2) + \dots \log f(x_n).$$

Let us suppose that n observations are taken on the quantities  $z_1$ , and  $z_2$ . The most probable values of these quantities will make P maximum,

$$\frac{dP}{Pdz_1} = \frac{df(x_1)}{f(x_1)dz_1} + \frac{df(x_2)}{f(x_2)dz_1} + \dots + \frac{df(x_n)}{f(x_n)dz_1} = 0 . \quad (3)$$

$$\frac{dP}{Pdz_2} = \frac{df(x_1)}{f(x_1)dz_2} + \frac{df(x_2)}{f(x_2)dz_2} + \dots + \frac{df(x_n)}{f(x_n)dz_2} = 0 . \quad (4)$$

We have

$$df(x_1) = \phi(x_1)f(x_1)dx_1 df(x_2) = \phi(x_2)f(x_2)dx_2 df(x_n) = \phi(x_n)f(x_n)dx_n$$
 (5)

By differentiating  $\log f(x_1)$  with respect to  $x_1$ , we have

$$\frac{df(x_1)}{f(x_1)dx_1} = \phi(x_1). \quad \text{Or} \quad df(x_1) = \phi(x_1) \ f(x_1)dx_1.$$

Substituting (5) in (3) and (4), we have

$$\phi(x_1) \frac{dx_1}{dz_1} + \phi(x_2) \frac{dx_2}{dz_1} + \dots + \phi(x_n) \frac{dx_n}{dz_1} = 0 \quad . \quad . \quad (6)$$

$$\phi(x_1)\frac{dx_1}{dz_2} + \phi(x_2)\frac{dx_2}{dz_2} + \dots + \phi(x_n)\frac{dx_n}{dz_2} = 0$$
 (7)

The equations may be simplified as follows: Consider that z has been measured n times, giving  $m_1, m_2, \ldots m_n$  as results. Then

$$\begin{aligned}
 z_1 - m_1 &= x_1 \\
 z_1 - m_2 &= x_2 \\
 \hline
 z_1 - m_n &= x_n
 \end{aligned}$$

Since  $m_1$ ,  $m_2$ , and  $m_n$  are constants, we have

$$\frac{dx_1}{dz_1} = 1; \quad \frac{dx_2}{dz_1} = 1; \quad \frac{dx_n}{dz_1} = 1; \quad \dots$$
 (8)

and similar results follow for  $dz_2$ .

This greatly simplifies Eqs. (6) and (7) and produces

$$\phi(x_1) + \phi(x_2) + \dots + \phi(x_n) = 0.$$
 (9)

#### Errors and Residuals

We must now make a brief digression in order to illustrate the difference between errors and residuals. Take the following measurements, of equal weight:

$$m_1 = 430.6$$
  
 $m_2 = 429.9$   
 $m_3 = 431.1$   
 $m_4 = 430.8$ 

By universal custom the mean of these results, 430.6, is taken as the best attainable value. (Later a mathematical proof of this will be given.)

The differences between the measurements and the mean are called residuals, and are as follows:

$$v_1 = 0.0$$
  
 $v_2 = -0.7$   
 $v_3 = +0.5$   
 $v_4 = +0.2$ 

The algebraic sum of the residuals always equals zero, and this may serve as a check upon the work. Now if we had some way of knowing that 430.6 was the correct result, we would transform those residuals into errors and designate them by  $x_1$ ,  $x_2$ ,  $x_3$ , and  $x_4$ .

A residual, then, is the difference between a measurement and the best attainable result; an error is the difference between a measurement and the true result.

It is obvious, first, that we cannot determine the values of the errors; and secondly, that the sum of the errors will approach the sum of the residuals as we increase the number of measurements.

Going back to Eq. (9), we may assume that n is sufficiently large so that we can apply the above law. Then, since the sum of the residuals is always zero, one may take the sum of the errors to be zero, and write

$$x_1+x_2+\ldots x_n=0.$$

From this it follows that  $\phi$  is a constant, which we may call c.

If we substitute the values of  $\phi(x_1)$ ,  $\phi(x_2)$ , and  $\phi(x_n)$ for (5) in (9), we obtain

$$\frac{df(x_1)}{f(x_1)dx_1} + \frac{df(x_2)}{f(x_2)dx_1} + \dots + \frac{df(x_n)}{f(x_n)dx_1} = cx_1 + cx_2 + \dots + cx_n.$$

Since this holds for any number of observations, the corresponding terms are equal. Omitting subscripts we have in general

$$\frac{df(x)}{f(x)dx} = cx.$$

Substitute values from (1) and integrate. We have

$$\log y = \frac{cx^2}{2} + k',$$
$$y = e^{\frac{1}{2}cx^2}e^{k'}.$$

$$y = e^{\frac{1}{2}cx^2}e^{k'}.$$

c is negative (why?) and may be replaced for the sake of convenience by  $-2h^2$ . We may also replace  $e^{k'}$  by k. Then  $y=ke^{-h^2x^2}$ , which is the equation of the probability curve. It is similar in form to the equation suggested to express the curve in Fig. 1.

This is the most important equation in the theory of precision of measurements and its meaning should be clearly understood.

#### **PROBLEMS**

- 1. Show from the curve that positive and negative errors are equally likely to occur.
- 2. Show that k represents the probability of the error zero.
  - 3. Explain why h is called the measure of precision.
  - 4. Show that the curve is horizontal over the origin.
  - 5. Show that a point of inflection occurs when

$$x = \pm \frac{1}{h\sqrt{2}}$$

#### THE PROBABILITY INTEGRAL

In order to express the probability that a certain group of errors will be made we integrate between the limits concerned. As this involves compound probability, we have

$$P = \frac{k}{dx} \int_{x_2}^{x_1} e^{-h^2 x^2} dx.$$

For certainty P=1 and the limits become  $+\infty$  and  $-\infty$ .

$$1 = \frac{k}{dx} \int_{-\infty}^{+\infty} e^{-h^2x^2} dx.$$

This is a well-known integral and is discussed in various treatises on the calculus. It equals  $\frac{\sqrt{\pi}}{h}$ , and therefore

$$1 = \frac{k\sqrt{\pi}}{dxh}, \quad k = \frac{hdx}{\sqrt{\pi}}.$$

and the probability equation becomes

$$y = hdx\pi^{-\frac{1}{2}}e^{-h^2x^2}$$
.

For compound probability

$$P = \frac{h}{\sqrt{\pi}} \int_{x_2}^{x_1} e^{-h^2 x^2} dx.$$

The probability that an error lies between +x and -x is double the probability that it lies between x and 0. We have

$$P = \frac{2h}{\sqrt{\pi}} \int_0^x e^{-h^2x^2} dx.$$

This may take the form

$$P = \frac{2}{\sqrt{\pi}} \int_0^{hx} e^{-h^2x^2} d(hx).$$

This is the usual form of the probability integral. h may be determined in a manner to be explained later; then by use of a table the probability of any desired magnitude may be obtained. The student is referred to any of the larger text-books on *Least Squares* for illustrations.

#### **EXERCISES**

In order to become familiar with the terms h and k, the following curves should be plotted:

- 1. Consider h constant. Give k the values 1, 2, 3, 4. Plot a curve for each value.
- 2. Consider k constant. Give h the values  $\frac{1}{4}$ ,  $\frac{1}{2}$ , 1, 2. In each case select a series of rather small numbers for x and use the formula

$$y = ke^{-h^2x^2}.$$

3. If time permits, a set of curves should be constructed in which both h and k are variables, x and y having constant values.

If we take the product of a number of single probabilities, we obtain

$$P = y_1 y_2 \dots y_n = k^n e^{-h^2(x_1^2 + x_2^2 + \dots x_n^2)}$$

An inspection of this equation shows us that the probability is greatest when the expression in the parenthesis is least. But these numbers are the squares of the errors (residuals, see page 12). It follows that the most probable values of observed quantities are those which make the sum of the squares of the residuals the least. From this law is derived the term Least Squares.

#### THE ARITHMETICAL MEAN

We are now prepared to prove that in a set of observations, the arithmetical mean has the greatest probability.

Let M be the mean of observations  $m_1, m_2 \ldots m_n$ . Then

$$M-m_1$$
,  $M-m_2 \ldots M-m_n$  are residuals.

We may make the sum of their squares a minimum.

$$\frac{d}{dM}[(M-m_1)^2+(M-m_2)^2+\dots (M-m_n)^2]=0.$$

$$2(M-m_1)+2(M-m_2)+\dots 2(M-m_n)=0.$$

$$M=\frac{m_1+m_2+\dots m_n}{n}, \text{ the arithmetical mean.}$$

#### A CONSTANT INTERVAL. FORMULA

$$x=6\frac{(n-1)(m_n-m_1)+(n-3)(m_{n-1}-m_2)+\ldots}{n(n^2-1)}$$

For a constant interval the arithmetical mean should not be employed. This formula comes from formulae used in developing normal equations. See Mellor's *Higher Mathematics*, page 327.

If n is odd, the middle term does not appear. Use an even number of measurements.

#### ILLUSTRATIVE PROBLEMS

- 1. Kundt's experiment: 30.7, 43.1, 55.6, 67.9, 80.1, 92.3, 104.6, 116.9, 129.2, 141.7, 154.0, 166.1 cm. Ans. 12.3 cm.
- 2. Time of vibration of magnet bar: 3.25, 9.90, 16.65, 23.35, 30.00, 36.65, 43.30, 50.00, 56.70, 63.30, 69.80, 76.55, 83.30, 89.90, 96.65, 103.15, 109.80, 116.65, 123.25, 129.95, 136.70, 143.35. Ans. 6.67.
- 3. A problem illustrating this method may easily be suggested from measurements with a planimeter; also from the acceleration curve with a dropped fork.

#### WEIGHTS

Heretofore we have considered all our measurements to be of equal value. Suppose the length of a small object was measured with a micrometer gauge, a vernier reading to hundredths of a millimeter, a vernier reading to tenths of a millimeter, and a meter stick.

The following results might be recorded:

1.	Micrometer	3.542	$\mathbf{cm}$
2.	Vernier $A$	3.544	"
3.	Vernier <i>B</i>	3.54	"
4.	Meter Stick	3.55	"

The mean of these measurements, 3.544, is obviously not the best value, since some represent greater precision than others. If one attaches to these results a number indicating their relative values, such a number is called the

weight and is usually designated by p. (Latin, pondus, weight. Compare pound.) Further on, rules will be given for finding the weight of observations, but for the present we may use our judgment. No. 4 is evidently the least accurate and we may give it the weight 1. No. 3 comes next and we may call it 3. No. 1 and No. 2 are about alike in weight, with perhaps a little advantage in favor of No. 1. We may, therefore, assign 8 to No. 2 and 10 to No. 1. Putting our results in tabular form, we have:

No.	Obs. (m)	Weights (p)	Weighted Obs. (pm)
1	3 542	10	35.420
2	3.544	8	28 352
3	3.54	3	10 62
4	3.55	1	3.55

 $\Sigma p = 22$   $\Sigma pm = 77.942$   $\Sigma pm \div \Sigma p = \text{weighted mean} = 3.543$ 

The weighted mean may be proved to have the greatest probability in a manner similar to that employed for the unweighted mean.

### ★ PROBLEMS

1. In establishing a north and south line, the following readings were taken:

All readings were taken with equal care, but the first was taken twice and the third three times. Find the best value.

2. Joule's values of the mechanical equivalent of heat have been weighted by Rowland as follows:

```
442.8 (0); 427.5 (2); 426.8 (10);
428.7 (2); 429.1 (1); 428.0 (1);
425.8 (2); 428.0 (3); 427.1 (3);
426.0 (5); 422.7 (1); 426.3 (1).
```

He concludes that 426.9 best represents the result of Joule's work.

3. The sum of the angles of an equilateral triangle is found to measure 180° 9′. If the first angle has been measured six times, the second three times, and the third once, how should the error be distributed among the angles?

Additional problems in weighting will be given after the subject of precision of measurement has been discussed.

#### Subjects for Discussion

The following topics are suggested for those who may wish to pursue the subject further:

- 1. The part played by the theory of probability in the work of the U. S. Weather Bureau.
- 2. The bearing of the laws of probability upon popular superstitions. Read the Vice-Presidential address of Professor A. G. Webster, at Atlanta, Ga., Dec. 30, 1913. (Science, Jan. 9, 1914.)
- 3. Exceptional phenomena. Read Chapter 29 in Jevons's *Principles of Science*.
  - 4. Relation to gambling.

Dr. H. G. Burnham, of Chicago, thinks that the best way to wipe out gambling in America is to teach the children in the schools the laws of chance. He feels sure that the result of this would be that in childrend they would steer clear of the slot machine, and that when they grow up, they would shun the book maker and every other gambling magnate.

To quote further: "The ordinary gambler does not stop to count his chances when he sees that by betting a dollar he may win one hundred dollars. If he had been taught in school to see that in reality the chances were 200 to one against him, and that he was betting a dollar against fifty cents, he would keep his money in his pocket."

5. The use of the theory of probability in mortality tables.

#### CHAPTER III

#### THE ADJUSTMENT OF OBSERVATIONS

It is a frequent experience in making measurements that our results do not check. The measurements may be conditioned (see page 2). The sum of the angles of a triangle, for example, may not come out just 180°. Or they may be measurements which have a less degree of interdependence.

If we take O as the starting-point and measure a distance,  $m_1=6.2$  feet above O, then  $m_2=4.3$  above  $m_1$ ; then  $m_2=10.6$  above O; we observe that there is a discrepancy somewhere. In this case, an obvious method of adjustment would be to add 0.03 to the first and second observations and subtract it from the third. Since the discrepancy is 0.1, this adjustment would correct it to 0.01.

Theory. While this method would answer very well for the simple case in question, it would break down when applied to more extended measurements. The theory of the method of adjustment is as follows:

Suppose we have unknown quantities  $m_1, m_2 \dots m_n$ , and suppose n measurements are made upon these quan-

tities. Then if  $a, b, c, \ldots l$  are known constants and M the resulting measured quantity, we have

$$a_{1}m_{1}+b_{1}m_{2}+\ldots l_{1}m_{k}=M_{1}$$

$$a_{2}m_{1}+b_{2}m_{2}+\ldots l_{2}m_{k}=M_{2}$$

$$a_{n}m_{1}+b_{n}m_{2}+\ldots l_{n}m_{k}=M_{n}$$

Since there are more equations than there are unknowns it follows that in general no system of values will exactly satisfy them. Each equation has a most probable value for its unknown terms, but in each case there will be left a small residual v. We may write the equation:

$$a_{1}m_{1}+b_{1}m_{2}+\dots l_{1}m_{k}-M_{1}=v_{1}$$

$$a_{2}m_{1}+b_{2}m_{2}+\dots l_{2}m_{k}-M_{2}=v_{2}$$

$$a_{n}m_{1}+b_{n}m_{2}+\dots l_{n}m_{k}-M_{n}=v_{n}$$

For simplicity we may designate all the terms independent of  $m_1$  by K.

$$a_1m_1+K_1=v_1$$
, and by symmetry
$$a_2m_1+K_2=v_2$$

$$a_nm_1+K_n=v_n$$

Square both sides of these equations and add:

$$(a_1m_1+K_1)^2+(a_2m_1+K_2)^2+\ldots (a_nm_1+K_n)^2$$
  
= $v_1^2+v_2^2+\ldots v_n^2$ .

The greatest probability occurs when the right-hand member is a minimum. Placing the first derivative equal to zero, we have

$$a_1(a_1m_1+K_1)+a_2(a_2m_1+K_2)+\ldots a_n(a_nm_1+K_n)=0.$$

Similar equations may be written for  $m_2 cdots cdots m_n$ . These are called "normal equations" and their solution gives the most probable values of the observations under consideration.

Rules. We may now summarize the methods of adjusting observations as follows:

- 1. Write an observation equation for each observation.
- 2. Form a normal equation for each unknown by multiplying each observation equation by the coefficient of the unknown in that equation and adding the results.
- 3. Solve the normal equations by any method. These results are the most probable values.

After these "best values" have been found, the residuals should be computed, and the sum of their squares  $(\Sigma v^2)$  found. This value is less than that for any other possible values of the residuals.

#### ILLUSTRATIVE PROBLEM

1. Given the following observation equations,

$$3m_1 - 4m_2 + m_3 = -3$$

$$m_1 + 2m_2 + 2m_3 = 25$$

$$m_2 + m_3 = 10$$

$$m_1 + m_2 + m_3 = 16$$

Find the best values and the sum of the squares of the residuals.

We first find the normal equations by the rule. For  $m_1$ ,

$$9m_1 - 12m_2 + 3m_3 = -9$$

$$m_1 + 2m_2 + 2m_3 = 25$$

$$m_1 + m_2 + m_3 = 16$$

$$11m_1 - 9m_2 + 6m_3 = 32$$

For  $m_2$ ,

$$-12m_1 + 16m_2 - 4m_3 = 12$$

$$2m_1 + 4m_2 + 4m_3 = 50$$

$$m_2 + m_3 = 10$$

$$m_1 + m_2 + m_3 = 16$$

$$-9m_1 + 22m_2 + 2m_3 = 88$$

For  $m_3$ ,

$$3m_1 - 4m_2 + m_3 = -3$$

$$2m_1 + 4m_2 + 4m_3 = 50$$

$$m_2 + m_3 = 10$$

$$m_1 + m_2 + m_3 = 16$$

$$6m_1 + 2m_2 + 7m_3 = 73$$

Grouping the normal equations,

$$11m_1 - 9m_2 + 6m_3 = 32$$

$$- 9m_1 + 22m_2 + 2m_3 = 88$$

$$6m_1 + 2m_2 + 7m_3 = 73$$

Solving,

$$m_1 = 6.00$$
  
 $m_2 = 6.13$   
 $m_3 = 3.26$ 

To obtain the residuals, we substitute these values in the observation equations,

It would be an interesting exercise to try other values for  $m_1$ ,  $m_2$ , and  $m_3$  and compare the value of  $\Sigma v^2$  resulting, with the above values. If, for example, we choose  $m_1 = 6$ ,  $m_2 = 6$ ,  $m_3 = 3$ , it is obvious that the second residual is unity, which alone is greater than the value of  $\Sigma v^2$ .

The following observations were made on a triangle:

Angle  $A=45^{\circ}$ ; angle  $B=80^{\circ}$ ; angle  $C=54^{\circ}$ .  $A+B=126^{\circ}$ ;  $A+C=100^{\circ}$ ;  $A+B+C=180^{\circ}$ . Find best results. The observation equations are

$$m_1 = 45$$
  
 $m_2 = 80$   
 $m_3 = 54$   
 $m_1 + m_2 = 126$   
 $m_1 + m_3 = 100$   
 $m_1 + m_2 + m_3 = 180$ 

The student should construct the normal equations and find the best values for  $m_1$ ,  $m_2$ , and  $m_3$ .

MEASUREMENTS OF A LINE

$\overline{A}$	В	C	D	E	F	$\overline{G}$
			Fig. 2			
	AB	8=4.0 units		FG =	7.8 units	
	BC	7 = 5.1		AC =	9.0	
	CD	0 = 6.9		BD =	:11.9	
	DE	z = 2.0		DF =	· 8.2	
	EF	7 = 6.1		AG =	32.0	

Find the best values of the above measurements made along a line.

Here we have 10 observation equations which will reduce to six normal equations containing six unknown quantities, which may be solved in the usual way. The problem is inserted for the purpose of illustration; its solution is hardly worth while.

#### FORMULAE

When the number of equations is large and the constants are not whole numbers, it saves time and affords a check upon the work to use the following formulae:

$$aa = a_1^2 + a_2^2 + \dots a_n^2$$

$$ab = a_1b_1 + a_2b_2 + \dots a_nb_n$$

$$al = a_1l_1 + a_2l_2 + \dots a_nl_n$$

$$bb = b_1^2 + b_2^2 + \dots b_n^2$$

$$aM = a_1M_1 + a_2M_2 + \dots a_nM_n$$

The normal equations become

$$aam_1 + abm_2 + \dots alm_k = aM$$

$$bam_1 + bbm_2 + \dots blm_k = bM$$

$$alm_1 + blm_2 + \dots llm_k = lM$$

The following example will illustrate the use of these formulae:

# Observation Equations

$$6m_1 - 3m_2 = 15.1$$
  
 $2m_1 + 2m_2 = 13.9$   
 $m_1 - 2m_2 = 2.1$ 

$$aa = +36+4+1=+41$$
  
 $ab = -18+4-2=-16$   
 $bb = +9+4+4=+17$   
 $aM = +90.6+27.8+2.1=+120.5$   
 $bM = -45.3+27.8-4.2=-21.7$ 

$$41m_1 + 16m_2 = 120.5$$
  
 $-16m_1 + 17m_2 = -21.7$ 

Let the student compare these results with those found without the use of the formula.


#### **PROBLEMS**

1. Adjust the following values and find  $\Sigma v^2$ :

$$m_1 = +3.06$$
 $m_2 = -1.30$ 
 $m_1 + m_2 = +1.75$ 
 $m_1 + m_2 = +4.81$ 

- 2. Heretofore it has been assumed that all observations have equal weights. If the weights are unequal each observation equation should be multiplied by the square root of its weight and the normal equation then formed. In the preceding example let the first and the second measurements have weights of one each, the third a weight of four, and the fourth a weight of nine, and find the adjusted values.
- 3. The following observations are taken from a student's field book:

$$M = 147^{\circ} 14' 04.5''$$
 $N = 88 58 06.1$ 
 $O = 93 51 26.7$ 
 $P = 29 56 16.6$ 
 $M+N+O+P=359 59 55.0$ 
 $M+N+O=330 3 39.2$ 
 $N+O+P=212 45 53.0$ 
 $O+P+M=271 1 57.8$ 
 $P+M+N=266 8 30.0$ 

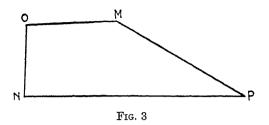

Find the best values of the angle-

4. 
$$A = 22^{\circ} 13' 59''$$

$$B = 100 18 40$$


$$C = 57 27 33$$

$$A + B = 122 32 41$$

$$B + C = 157 46 10$$


$$C + A = 79 41 29$$

$$A + B + C = 180 00 3$$

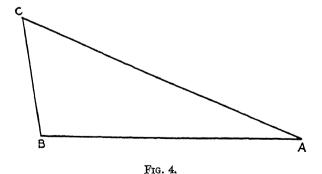

Find the best values of the angles.

# 5. Adjust the following angles:






Fig. 5.

No	Observed Angles.		
1	70°	20′	$51^{\prime\prime}$
2	52	35	10
3	50	41	25
4	95	10	41
5	91	11	<b>57</b>
6.	198	27	14

Observe that angle 6=angle 2+angle 3+angle 4.

6. Clairaut's empirical formula for the relation between the length of a seconds pendulum and the latitude is

$$l=L_0+A\sin^2 L$$
.

Suppose the following observations to be made:

$oldsymbol{L}$	l
0° 0′	0.990564
18 27	0 991150
48 24	0.993867
58 15	0.994589
67 4	0.995325

Substitute the values in the given equation for observation equations; then form normal equations for  $L_0$  and A. Mellor gives these normal equations:

$$0.993099 = L_0 + 0.44765A$$
,  
 $0.994548 = L_0 + 0.70306A$ .

# Systematic Errors

The above method of treatment applies only to accidental errors. If there should happen to be a systematic error running through the problem it is difficult or impossible to detect it from the observations themselves. There may be a mistake on the part of the observer or the error may be due to inexact graduation of the instruments, or it may be due to personal peculiarities. (See page 3.) It is beyond the scope of this book to present the theory of systematic errors, but the following problem may be read over with profit:

$$B = 86^{\circ} 45' 25.2'' + \sqrt{2}$$
 $A = 85 48 36.4 + \sqrt{2}$ 
 $C = 81 16 40.9 + \sqrt{3}$ 
 $D = 106 11 17.5 + \sqrt{4}$ 
 $A + B + C + D = 360 2 00$ 
 $A + B = 172 34 10.6$ 
 $B + C = 168 2 15.1$ 
 $C + D = 187 28 13.8$ 
 $D + A = 191 59 11.3$ 

The solution according to the method above outlined gives

 $m_1 = 85^{\circ} 48' 26.2''$   $m_2 = 86 45 32.2$   $m_3 = 81 16 50.1$  $m_4 = 106 11 9.5$ 

These are the best values, but it will be noted that the sum of these values is 1'58" greater than 360°. Presumably, a systematic error of about 30' runs through the observations. These values, then, may be further adjusted by finding the weight of each observation and distributing the discrepancy inversely as the weights. The probable error of each observation is given by the formula

$$R = 0.6745 \sqrt{\frac{\Sigma v^2}{n-q}},$$

Where n is the number of observations and q the number of unknown quantities. In this case n-q would be 5.

 $\Sigma v^2$  is obtained in the usual manner and found to be 1303. Next we may proceed to find the weights of the various measurements. If we wish to find the weight of  $m_3$ , for example, we should represent the absolute term in the normal equation of  $m_3$  by some constant and place the other absolute terms equal to zero. We solve for  $m_3$  and the weight is found to be the reciprocal of the coefficient of the constant. The probable error of  $m_3$  is found by dividing the probable error of each observation by the square root of the weight just found. The discrepancy in the final result may now be adjusted according to the weights found, and should give

$$m_1 = 85^{\circ} 47' 56.7''$$
  
 $m_2 = 86 45 2.7$   
 $m_3 = 81 16 20.6$   
 $m_4 = 106 10 40.0$ 

The sum of the angles is now found to be exactly 360°. By the principle of least squares the sum of the squares of the residuals is greater than for the "best values" previously obtained. This seems to confirm the suggestion that a constant error ran through the observations. A full discussion of this subject is given in Palmer's "Theory of Measurements," page 117.

#### SHORTER METHODS

The following abbreviated methods are sometimes employed:

## MAYER'S METHOD

Make all the coefficients of  $m_1$  positive and add the results to form a normal equation for  $m_1$ . Similarly for  $m_2 \ldots m_n$ . Solve the normal equations as before.

The results are not so accurate as those obtained by the longer method, but are satisfactory for most purposes.

#### **PROBLEMS**

Observation equations.

$$x-y+2z = 3$$

$$3x+2y-5z = 5$$

$$4x+y+4z=21$$

$$-x+3y+3z=14$$

Solve by the regular method and by Mayer's method. Some idea of their relative accuracies may be obtained by computing  $\Sigma v^2$  in each case.

Method by Diminishing the Constant Term Suppose we have given

$$A+B=10$$
  
 $4A-B=19$   
 $2A+3B=25$ 

An inspection of these equations shows that A=6 and B=4 approximately.

Let  $\hat{a}$  and b equal the difference between the true and approximate values of A and B. Then

$$(6+a)+(4+b)-10=0$$

$$4(6+a)-(4+b)-19=0$$

$$2(6+a)+3(4+b)-25=0$$

$$a+b=0$$

$$4a-b+1=0$$

$$2a+3b-1=0$$

Forming normals and solving, we have

$$a = -0.153$$
  
 $b = +0.406$   
 $A = 6 -0.153 = 5.847$   
 $B = 4 +0.406 = 4.406$ 

The student should compare these results with those obtained by the regular method.

This method is especially well adapted to the adjustment of angles observed at a station. Considerable mathematical computation is avoided. The following problem from the United States Lake Survey is solved in Merriman's Least Squares.

No.	Between Stations.		Obse	rvatı	on.
1.	Bunday and Wheatland	44°	25'	40'	<b>'.613</b>
2.	Bunday and Pittsford	80	47	<b>32</b>	.819
3.	Wheatland and Pittsford	36	21	51	.996
4.	Pittsford and Reading	91	34	24	.758
5.	Pittsford and Bunday	279	12	27	.619
6.	Reading and Quincy	62	37	43	.405
7.	Quincy and Bunday	125	00	18	.808
	We may set up the observation equati	ons:			

$$m_1 = 44^{\circ} 25' 40''.613$$
 $m_1 + m_3 = 80 ext{ } 47 ext{ } 32 ext{ } .819$ 
 $m_3 = 36 ext{ } 21 ext{ } 51 ext{ } .996$ 
 $m_4 = 91 ext{ } 34 ext{ } 24 ext{ } .758$ 
 $360^{\circ} - (m_1 + m_3) = 279 ext{ } 12 ext{ } 27 ext{ } .619$ 
 $m_6 = 62 ext{ } 37 ext{ } 43 ext{ } .405$ 
 $360^{\circ} - (m_1 + m_3 + m_4 + m_6) = 125 ext{ } 00 ext{ } 18 ext{ } .808$ 

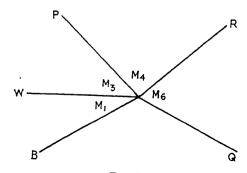


Fig. 6.

On account of the nature of the constant terms the solution would be extremely tedious. We may let  $v_1$ ,  $v_3$ ,  $v_4$ , and  $v_6$  be the most probable corrections to be applied. Then

$$m_1 = 44^{\circ} 25' 40''.613 + v_1$$
  
 $m_3 = 36 21 51 .996 + v_3$   
 $m_4 = 91 34 24 .758 + v_4$   
 $m_6 = 62 37 43 .405 + v_6$ 

This gives rise to simpler observation equations:

$$v_1 = 0$$

$$v_1 + v_3 = +0.210$$

$$v_3 = 0$$

$$v_4 = 0$$

$$v_1 + v_3 = -0.228$$

$$v_6 = 0$$

$$v_1 + v_3 + v_4 + v_6 = +0.420$$

The right-hand members denote seconds. The normal equations are

$$4v_1 + 3v_3 + v_4 + v_6 = +0.402$$

$$3v_1 + 4v_3 + v_4 + v_6 = +0.402$$

$$v_1 + v_3 + 2v_4 + v_6 = +0.420$$

$$v_1 + v_3 + v_4 + 2v_6 = +0.420$$

From which

$$v_1 = +0$$
".022  
 $v_3 = +0$  .022  
 $v_4 = +0$  .126  
 $v_6 = +0$  .126

# The adjusted values now become,

No. 1	44°	25′	40′	′.635
2	80	47	32	.653
3	36	21	52	.018
4	91	34	24	.884
5	279	12	27	.347
6	62	37	43	.531
7	125	00	18	.932

#### CHAPTER IV

# THE PRECISION OF OBSERVATIONS

As stated in the introductory chapter, there are no measurements made with such a degree of accuracy that we may regard them as absolutely correct. The wavelength of cadmium light has been measured with an accuracy which is marvelous, but its exact value will probably never be known. Since measurements differ among themselves in accuracy, it is desirable to have some method of indicating this fact, and the term "Precision of Observations" or "Precision of Measurements" is applied to the method of procedure employed in determining the relative accuracy of measurements. Strictly speaking, the term "deviation" is a better one than "accuracy" because the latter term seems to presuppose a knowledge of exact results.

The percentage of error is obtained by dividing the difference between the result obtained and the true result by the true result, and multiplying by 100. Here the "true result" may mean the best obtainable result.

The percentage of deviation is obtained by dividing the difference between two results, neither one of which may be regarded as necessarily correct, by either result, and multiplying by 100.

#### **PROBLEMS**

- 1. If a student brings a value for g of 981.7 cm. per sec. per sec. at a place where the best determinations give 980.6, what is his percentage of error? Would the term "deviation" apply here?
- 2. Find the percentage of deviation between two determinations of the density of mercury: 13.47 and 13.61.

Classes. There are three classes of precision measures:

- 1. Mean error;
- 2. Average deviation;
- 3. Probable error.

Graphic Method. These may be illustrated graphically by use of the probability curve (Fig. 7).

Since YOX may be regarded as a probability area, and since, as will be shown later, the probability that the true result lies within the limits indicated by the

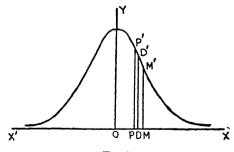


Fig. 7.

precision measure is one-half, it follows that we may express our precision in one of three ways:

- 1. By taking the distance from 0 along the x-axis to the point of inflection of the curve. This is represented by OM and expresses the mean error or mean square error.
- 2. By taking the abscissa of the ordinate passing through the center of gravity. This is *OD* and expresses the average deviation.
- 3. By taking the abscissa of the ordinate which divides YOX into equal parts. This is OP and expresses the probable error.

By reference to Problem 5, page 14, it will be seen that the mean error,  $\mu = \frac{1}{h\sqrt{2}}$ , the distance OM in the figure.

The average deviation, OD, may be found by use of the formula in mechanics

$$X = \frac{k \int_0^\infty x e^{-h^2 x^2} dx}{k \int_0^\infty e^{-h^2 x^2} dx} = \frac{1/2h^2}{\sqrt{\pi}/2h} = \frac{1}{h\sqrt{\pi}}.$$

The probable error,  $OP = \frac{0.4769}{h}$ . This will be deduced later.

Of these precision measures, it may be said that the mean error, "the square root of the arithmetical mean of the squares of the errors," is seldom used; the probable error is the most accurate; and the average deviation is the easiest to determine.

# THE AVERAGE DEVIATION

If m is the mean of n measurements and  $v_1, v_2, v_3, \ldots$   $v_n$  the residuals (neglecting signs), the average deviation would be  $a.d. = \frac{\sum v}{n}$ .

Taking the numbers 10, 8, 9, 10, the mean is 9.25, and  $v_1 = 0.75$ ,  $v_2 = 1.25$ ,  $v_3 = 0.25$ , and  $v_4 = 0.75$ .  $\Sigma v = 3.00$  and a.d. = 0.75. We may neglect the signs of the residuals.

This is the average deviation of a single observation.

The average deviation of the mean,  $A.D. = \frac{a.d.}{\sqrt{n}}$ . In the problem just solved,  $A.D. = \frac{0.75}{2} = 0.38$ .

#### **PROBLEMS**

It will prove of interest if the instructor will assign problems taken from the student's laboratory note-book in illustration of this topic.

## THE PROBABLE ERROR

The term probable error is rather misleading, but its meaning may be made clear by the following definition: The probable error is a number placed after a result with a plus and minus sign between them; and it indicates that it is an even wager that the true result lies between the indicated limits, and that it does not so lie.

At first thought, this definition seems vague and not indicative of a very high order of precision. Let us take the value of the velocity of light as 299860±30 km. per second. This means that it is just as likely that the true value lies between 299830 and 299890 as that it lies between

zero and 299830, plus 299890 to infinity. This narrows the field and indicates an order of precision that is sufficiently high.

The probable error is sometimes defined as a quantity, which, when added to and subtracted from the mean, gives limiting values such that if another mean is determined in a similar manner, its value is as likely to lie outside these limits as to lie between them.

#### FORMULAE FOR PROBABLE ERROR

Going back to the probability integral, we must take the value of x when  $P = \frac{1}{2}$ . This gives  $\frac{1}{2} = 2/\sqrt{\pi} \int_0^{hx} e^{-h^2x^2} dhx$ .

From integration tables we find hx = 0.4769.

The particular value of x which fulfills this condition will be denoted by r. Then hr = 0.4769.

Take the equation for compound probability (page 15).

$$P = h^2 dx^n \pi^{-n/2} e^{-h^2 \Sigma x^2}$$

Since h is the measure of precision, we wish to give it such a value as will render P a maximum.

$$\frac{dP}{dh} = nh^{n-1}e^{-h^2\Sigma x^2} - h^n e^{-h^2\Sigma x^2} 2h\Sigma x^2 = 0$$

$$n - 2h^2\Sigma x^2 = 0$$

(Divide by  $h^{n-1}e^{-h^2\Sigma x^2}$ )

$$h = \sqrt{\frac{n}{2\Sigma x^2}}.$$

But 
$$h = \frac{0.4769}{r}.$$

Therefore 
$$r = 0.4769 \sqrt{\frac{2\Sigma x^2}{n}} = 0.6745 \sqrt{\frac{\Sigma x^2}{n}}$$
.

This is the probable error for a single observation when errors are considered.

In order to change errors to residuals (x to v), we make use of the following procedure: Let the sum of the squares of the errors differ from the sum of the squares of the residuals by some constant, say  $u^2$ . Then

Now 
$$\Sigma x^2 = \Sigma v^2 + u^2.$$

$$u^2 = \frac{\Sigma x^2}{n};$$

$$\Sigma x^2 = \Sigma v^2 + \frac{\Sigma x^2}{n};$$

$$(n-1)\Sigma x^2 = n\Sigma v^2;$$

$$\frac{\Sigma x^2}{n} = \frac{\Sigma v^2}{n-1}.$$

Substituting in the formula for r,

$$r = 0.6745 \sqrt{\frac{\Sigma v^2}{n-1}}.$$

This is the formula for single observations for residuals. Since probable errors are inversely proportional to the squares of the number of observations taken (see any text-book on Least Squares), we have

$$n: 1:: 1/r_0^2: 1/r^2,$$
  
 $r_0 = r/\sqrt{n}.$ 

 $r_0$  thus represents the probable error of the mean and may be written  $r_0 = 0.6745 \sqrt{\frac{\sum v^2}{n(n-1)}}$ .

We may now summarize the relation between the probable error, the measure of precision, and the weight as follows:

- 1. The measure of precision varies inversely as the probable error (since hr = constant).
- 2. Weights are proportional to the squares of the precision measures.
- 3. Weights are inversely proportional to the squares of the probable errors.

#### **PROBLEMS**

1. Given the following measurements of the length of a line:

70.6 cm.	$70.5~\mathrm{cm}$ .	70.4 cm.
70.5 ''	70.6 ''	70.5 ''
70.7 ''	70.8 ''	70.6 ''

Find the mean square error, the average deviation, and the probable error.

- 2. Assume that the lines OP, OD, and OM are drawn to scale in Fig. 7, and compare their relative lengths with the results of No. 1.
  - 3. Given the measurements and probable errors:

 $427.32\pm0.04$  $427.30\pm0.16$ .

Find the relative weight and the relative precision.

- 4. Twenty measurements of a line give a probable error of the mean of 0.06. How many additional measurements are required to reduce the probable error to 0.03?
- 5. An angle is measured 9 times with each of two transits. The first gives a value of

The second gives

$$41^{\circ} 32' 12'' + 7'' 1.$$

Find the best value for the angle.

6. When the best value is found from No. 5, its probable error may be found by use of the formula

$$r_f^2: r_a^2 :: p_a: p_f$$

where  $r_f$ =probable error in the best value;

 $r_a$  = probable error in the first value;

 $p_a$ =weight of first value;

 $p_f$ =weight of first value+weight of second value.

The precision measure is sometimes expressed as a fraction or a decimal with reference to the magnitude of the measurement concerned. Thus in Problem 3, we may say that 0.04 is the precision measure, or we may say that the measurement is reliable to about 0.01%, or to one part in 10,000.

#### **PROBLEMS**

- 1. Show from the data on page 37 that r=0.85 a.d.  $=0.67\mu$ .
  - It follows that for a constant value of n,  $r_0 = 0.85$  A.D.
- 2. The following results have been obtained from nine measurements in each case:

94.31 cm. A.D. = 0.03194.36 " a.d. = 0.09094.35 " r = 0.02594.33 "  $r_0 = 0.007$ 94.34 " reliable to 0.03%94.35 " precise to 2 parts in 10,000

Reduce these different precision measures to A.D.'s and write them in order of the reliability of the results.

The fact that the size of the probable error must be considered in relation to the magnitude of the number with which it is written may be illustrated by Fletcher's result for the number of molecules in a gram-molecule of air:  $N=60.3\times10^{22}\pm1.2\times10^{22}$ . (Phys. Rev., November, 1914.)

### CHAPTER V

#### THE PROPAGATION OF ERRORS

In the study of the propagation of errors we have two classes of problems—the direct and the converse. In the first class we determine how the errors in component measurements affect the reliability of the results; and in the converse problem we determine with what accuracy we should make our component measurements in order to secure a required accuracy in the result.

In solving problems under the first case, we proceed as follows: If Z represents the true result, and X its error; and  $z_1, z_2, \ldots z_n$  are true values of component measurements, and  $x_1, x_2, \ldots x_n$  are their corresponding errors, then,

$$Z+X=f[(z_1+x_1), (z_2+x_2)...(z_n+x_n)].$$

By Taylor's theorem

$$X = \frac{dZ}{dz_1}x_1 + \frac{dZ}{dz_2}x_2 + \dots \frac{dZ}{dz_n}x_n.$$

Consider that we have a series of such terms, designated by  $\Sigma X$ ,  $\Sigma x_1$ ,  $\Sigma x_2$ , etc., and square both sides:

$$\Sigma X^2 = \left(\frac{dZ}{dz_1}\right)^2 \Sigma x_1^2 + \left(\frac{dZ}{dz_2}\right)^2 \Sigma x_2^2 + \dots + \left(\frac{dZ}{dz_n}\right)^2 \Sigma x_n^2.$$

We have neglected terms containing the products of the errors, such as  $\Sigma x_1x_2$ , since positive and negative errors are equally likely to occur. If we divide both sides by n, we may substitute  $r^2$  (the probable error in the final result) for  $\frac{\Sigma X^2}{n}$  and  $r_1^2$ ,  $r_2^2$ ,  $r_2^2$ , the probable errors of the components for  $\frac{\Sigma x_1^2}{n}$ , etc. The reason for this is evident from an inspection of the probable error formula. Thus we have

$$r^2 = \left(\frac{dZ}{dz_1}\right)^2 r_1^2 + \left(\frac{dZ}{dz_2}\right)^2 r_2^2 + \dots \left(\frac{dZ}{dz_n}\right)^2 r_n^2.$$

Hereafter we shall replace r by  $\Delta$  and  $r_1, r_2 \ldots r_n$  by  $\delta_1, \delta_2, \ldots, \delta_n$ . These refer to any precision measure as well as the probable error.  $\Delta$  means the deviation in the result due to deviations in the components,  $\delta_1, \delta_2, \ldots, \delta_n$ .

#### ILLUSTRATIVE PROBLEMS

1. The two sides of a rectangle measure  $45\pm0.6$  and  $50\pm0.4$ . Find the deviation in the area. The formula is A=ab=2250.

$$\begin{split} \Delta^2 &= \left(\frac{d(ab)}{da}\right)^2 (\delta_a)^2 + \left(\frac{d(ab)}{db}\right)^2 (\delta b)^2 \\ &= (50)^2 (0.6)^2 + (45)^2 (0.4)^2 \\ &= 900 + 324 = 1224 \\ \Delta &= 35 \text{ approximately.} \end{split}$$

We may say, then, that the area (expressed in square feet), is 2250 with a deviation measure of 35.

- 2. It may be readily seen from the formula that if the equation has the form A = a + b, the value of  $\Delta^2$  becomes  $\delta_a^2 + \delta_b^2$ . This may be applied to the measurement of a line which has to be made in sections.
- 3. If the equation contains a constant multiplier, A = ca, we have  $\Delta = c\delta$ .

If the radius of a circle is 10 cm. with a deviation of 0.1, the deviation of the resulting length of the circumference is  $2\pi \times 0.1 = 0.63$ .

#### PROBLEMS

1. The formula for the radius of a sphere as given by a spherometer is

$$R = \frac{l^2}{6a} + \frac{a}{2}$$
.

Tf

$$l = 7.23 \pm 0.04$$
 cm.,

and

$$a = 0.53 \pm 0.008$$
 cm.

find the length of the radius and its deviation measure.

- 2. If the length of a pendulum is  $100\pm0.1$  cm., and the period of one vibration  $1.01\pm0.003$  seconds, what is the deviation in g?
- 3. The mass of a body in air is  $30\pm0.1~g$ ; in water  $20\pm0.2~g$ . Find the deviation in the value of its specific gravity.
- 4. What is the deviation in the value of the velocity of liquid flow from a height of  $50\pm1$  cm.?  $V^2=2gh$ .
- 5. A mass of 100 g. is revolved with a speed of 80 cm. per second on the end of a cord 50 cm. long. The mass measurements are 101, 100, 99; the speed measurements

- 82, 80, 78; the length measurements 51, 49, 50. Find the centrifugal force and its deviation.
- 6. Find the deviation in the mean of two quantities which differ by C.
- 7. If d is the deviation in  $\log a$ , what is the deviation in a?
- 8. In No. 2, assume that the deviation found is an average deviation, A.D. Express the result fractionally, decimally, and as a probable error.
- 9. In determining a refractive index, the value of i is  $40^{\circ}\pm8'$ , and of r  $32^{\circ}\pm6'$ . Find the value of the index and its deviation.

In solving these problems, the student should observe the relative effects of the deviations in the components upon the result. In No. 2, for example, it will be seen that a deviation in t is a much more serious matter than an equal deviation in t. A large number of problems illustrating this process may be found in Goodwin's Precision of Measurements.

#### **PROBLEMS**

The following problems are of especial interest to engineering students:

1. In the triangle ABC,  $AB=500'\pm0.04' \angle A=32^{\circ}\pm10'$ ,  $\angle C=60^{\circ}\pm4'$ . Find BC and its deviation. The formula for the area of a triangle with the given conditions should be written down and the usual method employed. We have the deviations given for the angles and need them for the sines of the angles. For a deviation of 10 minutes in 32 degrees, we find the deviation in the sine of 32 degrees

by subtracting the sine of 32° from that of 32° 10′. Or we may differentiate with respect to the angle.

- 2. In a triangle ABC, we have  $AB=240.4\pm0.04$ ,  $AC=290.6\pm0.003$ ,  $\angle A=44^{\circ}20'\pm1'$ . Find the area and its deviation. Use both methods referred to above in dealing with the angle A.
- 3. The formula for the elastic modulus of a rectangular bar supported at its ends is  $E = \frac{Pl^3}{4dbh^3}$ , where P is the mass applied at the center, l the length, d the deflection produced, b and h the breadth and thickness. We have given the following measurements:

ъ	h	ď
0''.331	0'' 490	0''.206
0''.333	0'' 492	0" 205
0''.329	0''.491	0''.206
0''.330	0''.490	0''.207

Take the length two feet and P=40 lbs.

Find E and its deviation.

- 4. Find the number of calories and its deviation, from a current of  $6.2\pm0.06$  amperes, through a resistance of  $20\pm0.1$  ohms, for 30 minutes (correct to a single second).
- 5. Observations on a resistance of about 10 ohms give values as follows: Correct to 0.09%, correct to one part in one hundred; a probable error of 0.001. Write these down in the order of their relative reliabilities.

An interesting case of the effect of errors in observed values upon derived values is found when the derived value is the difference of two observed values, both of which are large in comparison with their difference.

For example, the area of the datum circle of a given plan-

meter is 2075 sq. cm. A student by measurement obtains the value of 2070 sq. cm., which is correct to less than one-fourth of one per cent. The student then traces a given figure with the fixed point at the center of the figure and the movable point moving in a counter-clockwise direction, giving the reading 2010 sq. cm. The area of the figure is, then, either 2075-2010=65 sq. cm., or 2070-2010=60 sq. cm., results which differ from each other by about eight per cent.

#### THE CONVERSE PROBLEM

In the cases already considered, we have discussed the effects of deviations in component measurements upon the deviation in the result. We are commonly called upon to determine in advance to what degree of precision we shall make our measurements in order to reach a given precision in our result. For example, we are required to measure the volume of a cylinder whose length is about 10 cm. and whose radius is about 3 cm. with such a degree of accuracy that the deviation in the volume (about 283 cm.3) shall not exceed 3 cm.3 It is customary to so adjust the deviations pertaining to each variable that each will have an equal effect upon the final result. This is called the method of equal effects. Representing the effects of the various deviations upon the results by  $\Delta_a$ ,  $\Delta_b$ , ...  $\Delta_n$ , we have  $\Delta^2 = \Delta_a^2 + \Delta_b^2 + \dots + \Delta_n^2 = n\Delta_a^2$ .  $\Delta = \Delta_a \sqrt{n}$ . In our problem we may write

$$\Delta_l = \Delta_r = \frac{\Delta}{\sqrt{n}} = \frac{3}{\sqrt{2}} = 2.1 \text{ cm}^3.$$

The deviations in the length and radius should not separately produce a deviation in the area of more than 2.1 cm.<sup>3</sup> From our general equation, page 45, we have

$$\Delta_l = \frac{dA}{dl} \delta l = \pi \tau^2 \delta l = 28.3 \delta l = 2.1.$$

Therefore  $\delta l = 0.074$  cm. Likewise

$$\Delta_r = \frac{dA}{dr} \delta_r = 2\pi r l \delta_r = 188.6 \delta_r = 2.1.$$
  $\delta_r = 0.011$  cm.

We conclude that we must measure the length of the cylinder with an accuracy of 0.074 cm., and the radius with an accuracy of 0.011 cm.

# THE FRACTIONAL METHOD

These problems may be solved in another way. It follows (not quite directly) from the method of equal effects that the deviation in a final result due to a deviation in a component bears the same relation to the final result as the deviation in the component bears to the component, if the exponent is unity.

In other words  $\frac{\Delta_l}{A} = \frac{\delta_l}{l}$ . If the component has any other exponent than unity, the fraction must be multiplied by the exponent, following the method of differentiation. We have in the last problem  $\frac{\Delta_r}{A} = \frac{2\delta_r}{r}$ , since the radius appears in the second power.

Since 
$$\Delta_i = \Delta_r = \frac{\Delta}{\sqrt{2}}$$
 we may write

$$\frac{\Delta_1}{A} = \frac{\Delta_7}{A} = \frac{1}{\sqrt{2}} \frac{\Delta}{A} = \frac{1}{\sqrt{2}} \frac{3}{283} = 0.0074$$

$$\frac{\delta_l}{l} = 0.0074; \quad \delta l = 0.074$$

$$\frac{\delta_r}{r} = \frac{1}{2} \times 0.0074 = 0.0037; \quad \delta_r = 0.011.$$

This is seen to check with the former method.

#### **PROBLEMS**

- 1. With what accuracy must we measure the radius of a circle to obtain an accuracy of 0.1% in the area? (First method.)
- 2. With what accuracy should l and t be measured in a simple pendulum to obtain a value of g correct to one unit? (Second method.)
- 3. With what accuracy should h and a be measured with a spherometer to give a value in the radius correct to 0.03%? This problem may be solved in a literal form or values may be assigned to a and b and the result computed. (First or second method.)

These are illustrative problems. They should be extended, so far as time permits, to include various problems from the student's laboratory note-book. The importance of this part of the subject is obvious.

#### BEST MAGNITUDES AND BEST RATIOS

No one can work very long in a physical laborator without observing that the results come out much bette by using certain magnitudes and ratios than they do with others. In measuring current with a tangent galvanom eter very poor results would be obtained for angles between 0°-20° and 70°-90°. Around 45°, however, they are satisfactory. In using a slide-wire Wheatstone bridge the two segments of the wire must be about equal for satisfactory results.

In the first case, our formula is  $I=c \tan \phi$ .

$$\Delta_{\phi} = \frac{d(c \tan \phi)}{d_{\phi}} \delta_{\phi} = \frac{c \delta_{\phi}}{\cos^2 \phi}.$$

Dividing

$$\frac{\Delta_{\phi}}{I} = \frac{c \, \delta_{\phi}}{\cos^2 \phi} \times \frac{1}{c \, \tan \phi} = \frac{2 \, \delta_{\phi}}{\sin 2\phi}.$$

This is a minimum when  $\phi=45^{\circ}$  and shows that the deviation in the result due to a deviation in  $\phi$  is least at  $45^{\circ}$ .

For the Wheatstone bridge we may let x= the unknown resistance, R the known, a and b the segments of the wire, and c its total length.

Then

$$x = \frac{aR}{c-a}$$
.

It should be easy for the student to prove that the best result occurs when a=b.

These illustrations might be indefinitely extended. The student is referred to Holman's *Precision of Measurements* for a number of interesting problems.

#### **EXERCISES**

- 1. Show that the relative error in measuring the area of a circle decreases with increasing radius.
- 2. In drawing a simple harmonic motion curve, discuss the effect of an error in the phase upon the displacement for various points on the curve.
- 3. A body rolls down an inclined plane for a definite period of time. Discuss the effect of an error in measuring the angle of the plane upon the error in velocity. Neglect friction.
- 4. How would an error of one minute in measuring the angle of incidence compare with a similar error in measuring the angle of refraction in their effect upon the refractive index? Take  $i=45^{\circ}$  and  $r=30^{\circ}$ .
- 5. What is the "best value" of the limiting angle in measuring the coefficient of friction?

6. In Lami's theorem 
$$\frac{A}{\sin \alpha} = \frac{B}{\sin \beta} = \frac{C}{\sin \gamma}$$

take 
$$A = 59.8$$
,  $B = 69.8$ ,  $C = 102.8$ ,  $\alpha = 146^{\circ}$ ,  $\beta = 139^{\circ}$ ,  $\gamma = 75^{\circ}$ .

Discuss the effect upon each term of an error of  $0^{\circ}.5$  in measuring  $\alpha$ ,  $\beta$ , and  $\gamma$ .

#### CHAPTER VI

#### PLOTTING

Definitions. It may be assumed that students for whom this book was prepared have a knowledge of the fundamental principles of curve tracing. A few familiar definitions and illustrations will, however, be given.

A plot is a graphic representation of the relation of two quantities of which one is a function of the other. The origin is the point of departure from which all distances are reckoned. The coordinates are horizontal and vertical distances from the origin. The axis of abscissas is the horizontal line through the origin. The axis of ordinates is the vertical line through the origin. The slope of the curve is the angle it makes with the x-axis.

When the points for a curve have been established, there are two methods of procedure: If the curve appears to be regular or to correspond with well-known types, we should draw an average line through the points in such a manner that about as many will lie on one side as on the other. If the curve does not fulfill these conditions, the adjacent points should be connected by straight lines.

#### EXERCISES

In these exercises, the student should use his judgment as to the method to be followed.

- 1. Plot a simple interest curve for \$100 for ten years at 5 per cent.
- 2. Plot a compound interest curve starting from the same origin.
- 3. The maximum temperature for each day of a certain month was as follows:

					1
1	31°	11	29°	21	11°
2	22	12	24	22	13
3	21	13	18	23	18
4	27	14	12	24	41
5	29	15	14	25	43
6	26	16	26	26	38
7	22	17	28	27	30
8	28	18	28	28	36
9	29	19	19	29	36
10	28	20	16	30	47

Plot the curve.

- 4. Compute the mean temperature for the month in No. 3, and plot a curve showing the departure from the mean for each day.
- 5. The following plot will afford amusement as well as instruction:

2	y .	x	y
-0.0	1.5	1.3	-1 0
-1.0	1.2	1.6	-0.3
-2.0	07	2 0	-0.4
-3.0	0.0	3.0	-0.5
-3.5	-0.5	3.3	-0.5
-3 7	-10	3.5	-0.3
-3.5	-1.7	3.3	0.0
-3.0	-2.2	3.0	0.6
-2.5	$-2 \ 3$	3.0	1.0
-1.0	-2.1	2 7	1.3
-0 5	-1.9	28	1.6
0.0	-2.3	2.5	1.5
0.5	-2.4	2.0	1.4
1.0	-2.5	10	1.6
0.8	-1.6	0.0	1.5
1.0	-1 3		
	<del></del>	<u> </u>	

6. A thermometer is found to have the following errors when calibrated by means of a standard:

Draw a curve of errors for the thermometer.

Determination of Constants. Let us take the equation of a straight line,

$$y = ax + b$$
.

By definition  $\frac{dy}{dx}$  is the tangent of the angle which the

line makes with the x-axis. This is equal to a and determines this constant. When x=0, y=b. This determines the constant b.

Rearrangement of this it scheetimes happens that if a curve is plotted in one way it is meaningless or difficult to interpret; while a tentangement of data makes it perfectly intelligible. If, for example, a tente of readings have been taken with a point slaw apparatus, the resulting curve should be an equilateral hyperbola (pv=a). It will be found, however, that the readings one is ordinarily able to obtain are not sufficient to identify the curve. If we change the data and plot v and 1/p we get a straight line.

In a tangent galvanometer the formula is I=k tan  $\phi$ . In order to get a series of variations in the current we introduce varying resistances. Since I=E/R, it follows that the reciprocals of the resistances will plot a straight line with tan  $\phi$ 

#### **EXERCISES**

1. The following data come from an experiment with the Boyle's law apparatus:

Volume.	Pressure.	Volume.	Pressure.
26.5	134.3	34.9	102.9
27.4	130.5	36. <b>2</b>	99.3
27.9	126.4	37.6	95.7
<b>28.2</b>	122.9	39.2	92.3
29.2	118.4	40.7	88.3
31.3	114.5	42.5	85.3
<b>32.4</b>	110.5	44.0	81.9
<b>3</b> 3.6	106.7	45.8	78.9

Discuss the accuracy of the observations from the plot.

2. The following table is made up from resistances and corresponding deflections with a tangent galvanometer:

Resistances (Ohms)	Deflections (Degrees)
90	5 3
50	8.7
30	12 8
20	16 7
10	24 0
5	30 6
3	34 5
1	39 3
0	42 5

a. Assume that we have a constant electromotive force and make a plot which will show the relation between the current and the deflection.

$$I=k \tan \theta,$$
  $I=E/R.$ 

- b. Plot the resistances with the cotangents of the angles and project until it cuts the x-axis. Interpret the curve.
  - c. Find the value of E by Ohm's law.
- 3. Known volumes of a liquid were placed in a flask and weighed, giving data as follows:

204 221 250 287 307

Plot the volume on the x-axis and the masses on the y-axis.

- a. Find the mass of the flask from the plot.
- b. Find the specific gravity of the liquid.
- 4. Two rulers were placed together at random and the reading on the centimeter scale was taken opposite each inch division on the English scale, giving data:

Inches	Centimeters.
0	
1	
2	27 8
3	25 3
4	22 7
5	20 2
6	17 7
7	15 1
8	12 6
9	10 0
10	7 5
11	5 0
12	2.4

Plot the inch readings on the x-axis and the centimeter readings on the y-axis.

- a. Determine from the plot how the rulers were placed with reference to each other.
- b. Find the ratio of the centimeter and inch by using the intercepts of the curve on the axes; also by using the ratio of the difference of two points  $y_2-y_1$  and  $x_2-x_1$ .
- 5. The candle-power of a 16-c.p., 110-v. lamp was measured for different voltages across the terminals as follows:

Volts.	Candle-power.
60	0.4
70	1.1
80	2.3
90	4.2
100	8. <b>3</b>
105	10.3
118	16.6
128	22.3
138	25.8
150	44.7
160	54.5
170	72.2
180	79.7
190	93.9
200	115.7
210	120 3

Plot volts on x and candle-powers on y-axis.

- a. Find candle-power at 110 v.
- b. Find candle-power at 220 v.
- c. Is it possible to estimate the voltage at which the filament first begins to glow?
- 6. The elongation of a spring was measured for different loads, and the energy stored in the spring computed, giving data:

g. cm g. cm. 0 0 0 0 50 2.3 57.5 100 5.4 270.0 150 8.8 660.0	Loads.	Elongation.	Energy.
100 5.4 270.0		1	g. em. 0
	50	2.3	57.5
150 8 8 660.0	100	5.4	270.0
	150	8 8	660.0
200 11 9 1190.0	200	11 9	1190.0
250 15 2 1900.0	250	15 2	1900.0

Plot loads (x) with elongations (y) and energy (y).

- a. Compute the constant of the spring (g/cm).
- b. We have

7

$$W = Fd = \left(\frac{O+L}{2}\right)E;$$

$$E = kL;$$

$$W = \frac{kL^{2}}{2}.$$

Interpret this equation and compare with the curve.

c. Compute the area between the load-elongation curve and the x-axis. What does this represent?

The electrical resistance of lead at various temperatures indicated by means of a plot that the resistance would be zero at  $-273^{\circ}$  C. The recent experiments of Professor Kamerlingh Onnes have justified this conclusion.

Inches.	Centimeters.	Weight Given.
0	0	
1	2 5	10
2	5.5	1
3	7.3	3
4	10 0	10
5	13 3	2
6	14 8	8
7	18 2	8
8	19 0	6
9	23 6	5
10	24 4	1
<u> </u>	'	

Plot the above, taking inches on the x-axis and centi-

meters on the y-axis. Draw an average straight line through the points and test its accuracy by reference to the equation  $\Sigma r=0$ , when the various perpendicular distances from the points to the line are expressed by  $r_1$ ,  $r_2$ , etc. Repeat the exercise, using the weights assigned above. Correct the line by use of the results obtained.

#### CHAPTER VII

#### NEGLIGIBILITY

Importance. It is of the utmost importance that students in laboratory courses should come to know under just what conditions they are at liberty to neglect small quantities which appear in their work. A student who comes into physics from courses in mathematics is conscious of a decided shock when he is told to throw away certain terms in an equation. It is hoped that a few illustrations will convince him that such a process is not at all unscientific or inaccurate.

We learn in trigonometry that the sine, tangent, and radian value of an angle may be used interchangeably if the angle is small. The following table will make this clear:

Degrees.	Radians.	Sine.	Tangent.
0°	0	0	0
0 30'	0 00873	0 00873	0 00873
1	0.01745	0 01745	0 01746
<b>2</b>	0 03491	0 03490	0 03492
3	0.05236	0 05234	0 05241
4	0 06981	0.06976	0 06993
5	0.08727	0 08716	0 08749

It will be seen that for most purposes very little error would result from substituting the radian measure or the tangent for the sine.

#### **EXERCISES**

1. Construct a circle with radius unity. Take an angle of 60° at the center and draw an arc and a chord. Call the arc dx and the chord dy (equal to the radius). Find the value of the arc by radians  $\left(\frac{2\pi}{6}\right)$ , and the chord by the law of sines. In this case dy=1 and dx=1.0472. Find relation between dx and dy for 30°, 10°, 5°, and 1°.

2. What is the largest angle for which dx=dy to four places of decimals?

The Pendulum Formula. In deducing the formula for the simple pendulum, we make use of an approximation, so that the equation  $T = 2\pi\sqrt{l/g}$  is not quite correct. The equation

$$T = 2\pi \sqrt{l/g} \left[ 1 + \left(\frac{1}{2}\right)^2 K^2 + \left(\frac{1.3}{2.4}\right)^2 K^4 + \dots \right]$$

tends to diminish the error as more and more terms are used. Here  $K = \frac{\theta}{2}$ .

#### **EXERCISE**

Give  $\theta$  values of 60°, 10°, and 1° and assume that the longer formula gives the correct value of g. Find the error in each case due to using the shorter formula. Remember that g appears as a square root.

The Mirror Formula. In developing the formula for the circular mirror a similar approximation is noted. By using a parabolic mirror no approximation appears.

#### **EXERCISES**

- 1. Show that light starting from the focus of a paraboloid of revolution will go in parallel lines upon reflection from any part of the mirror.
- 2. Construct a parabola whose equation is  $y^2 = 4px$ . Construct a circle internally tangent to this whose equation is  $x^2 + y^2 2rx = 0$ . Let r = 2p. Select points along the axis distant r/4, r/2, 3r/4, and r from the origin. Find the value of y on the circle and the corresponding value of y on the parabola in each case. The relation of these values may be used to measure the error due to the approximation.
- 3. Find the angular aperture at the center of the circle for each point taken.

Approximate Squares and Square Roots. There is a short method of squaring numbers and extracting their square roots which involves an approximation. Let us take the number 1.01 and consider it made up of 1.0+0.01. If we square this by use of the binomial theorem, we have

#### 1+0.02+0.0001=1.0201.

This is nearly equal to 1.02. If, therefore, we square our first term and add twice the second term, we have a rule for squaring such numbers as these. The square of 1.0019 is 1.0038036, to which 1.0038 is a close approxi-

mation. If the whole number is any other than unity, its value must be multiplied into the smaller term.

By a similar process we may find the square root of 1.04 to be 1.02, and that of 4.04 to be 2.01.

#### The Slide Rule

The slide rule is an instrument that gives approximate values and well illustrates the principle of negligibility. The following table shows its accuracy for certain processes:

Problem.	Solution by Slide	Solution by Five	Deviation,	
	Rule.	Place Logs	%	
$\begin{bmatrix} 152 \times 391 \times 31 \\ 86.4 \times 0.028 \times 4.95 \\ 496 \div 381 \\ 292 \div 468 \\ 25 \times 0.07 \times 1 \ 15 \\ \hline 378 \times 0 \ 98 \end{bmatrix}$	1842000	1842400	0 022	
	11.97	11.975	0 042	
	1.303	1 3018	0.092	
	0.624	0.62394	0.0096	
	0 00543	0.0054327	0.05	

The student should note the differences in the % of deviation.

The Value of  $\pi$ . Much energy has been expended in obtaining values of  $\pi$  correct to a large number of decimal places. It has been carried out to 707 places. (See Seven Follies of Science by Phin.) If  $\pi$  is carried out to six or seven places, it is sufficient for all purposes. The value  $3\frac{1}{7}$  will answer for the majority of cases. It will prove convenient to remember that  $\pi^2 = 9.87$  to a very close approximation.

#### **PROBLEMS**

- 1. Find the error due to using the value  $3\frac{1}{7}$  carried out to four decimal places, for  $\pi$ .
- 2. Find the error due to using the value 9.87 for  $\pi^2$ , when  $\pi$  is carried out to four places.
- 3. We are accustomed to assume in physics that the coefficient of cubical expansion of a solid is three times that of the linear expansion. What error does this involve when a bar of brass, 100 cm. long at 0° C., is heated to 100° C.?

The error involved in using a mirror and scale (Poggendorff's method) is discussed in Stewart and Gee's *Practical Physics*, Vol. I, p. 55.

#### CRITERIA FOR NEGLIBILITY

It often happens that in a series of measurements of the same quantity, there are one or more values which do not compare well with the others. The question arises, what shall be done with these observations? They seem to have been taken with equal care with the others, and there seems to be no particular reason for rejecting them. Several criteria have been proposed for testing such observations.

The Huge Error. We find the mean and average deviation (a.d.) omitting the doubtful observation; then find the difference between the doubtful observation and the mean, and if this equals or is greater than 4 a.d., it should be rejected.

Suppose we have a set of measurements: 10, 9, 10, 9, 12. The last measurement is questionable. The mean

is 9.5. a.d. = 0.5. 12-9.5=2.5.  $4\times0.5=2.0$ . The measurement should be rejected.

#### PROBLEM

The following length measurements (centimeters) have been taken: 60.1, 60.2, 60.3, 59.9, 58.3, 63.1. Apply the method to the last two results.

Chauvenet's Criterion. This is a more elaborate method. We may let t stand for the ratio between the limiting error (x) and the probable error of a single observation (r). If there are n errors, we may assume that nP will be the number less than x, and n-nP the number greater than x.

Then, by definition

$$n-nP = \frac{1}{2}.$$

$$P = \frac{2n-1}{2n}.$$

We have

$$P = \frac{2}{\sqrt{\pi}} \int_0^t e^{-t} dt. \quad \text{(See page 15.)}$$

If we equate these two values of P and solve, we may find a value of t corresponding to any value of n. A few common values of n are given:

n	ŧ	n	t	n	t
3	2 05	7	2.67	11	2.96
4	2 27	8	2.76	12	3.02
5	2 44	9	2.84	13	3 07
6	2 57	10	2.91	14	3.12

Since the limiting error, x=tr, we have only to find these two values and compare.

Let us take the following data: 12, 13, 12, 13, 13, 15. The mean is 13 and

$$\Sigma v^2 = 6$$
.  $r = 0.6745 \sqrt{\frac{\Sigma v^2}{n-1}} = 0.6745 \sqrt{\frac{6}{5}} = 0.74$ .  
 $n = 6$ ,  $t = 2.57$ .  $x = tr = 1.9$ .

For

The deviation of the term in question is 2.0 and it should be rejected.

#### PROBLEM

The following observations were taken with a transit,

Test such observations as may be necessary by Chauvenet's Criterion.

#### Criterion for Negligibility for Deviation in Components

When the deviation in any component contributes but little to the deviation in the result, it is sometimes proper to neglect it altogether. We know that the error in the final result,

$$\Delta = \sqrt{\Delta_1^2 + \Delta_2^2 + \ldots \Delta_r^2}$$

Suppose  $\Delta_2$  is the quantity under investigation. Let

$$\Delta_0 = \sqrt{\Delta_1^2 + \ldots \Delta_n^2},$$

where  $\Delta_2^2$  has been omitted.

 $\Delta - \Delta_0$  = the reduction in the deviation in the result due to omitting  $\Delta_2$ . We may assume this value to be anything we please, depending upon the accuracy we require. If we insist, as some authors suggest, that it be equal to or less than  $\frac{1}{10}\Delta$ , we have

$$\Delta_0 \equiv 0.9\Delta$$
.

But 
$$\Delta_2^2 = \Delta^2 - \Delta_0^2 = \Delta^2 (1 - 0.9^2) = 0.19\Delta^2$$
.  
 $\Delta_2 = 0.43\Delta$ .

We may thus neglect a deviation if it contributes less than 0.43 of the total deviation of the result. A more rigid criterion could, of course, be determined by substituting a smaller value for the  $\frac{1}{10}$ .

Significant Figures. This is a subject that may be properly treated under the head of negligibility. At each stage in a series of measurements the student should look over his work and eliminate such figures as lend nothing to its precision. A rather full treatment of this subject is given in Holman's *Precision of Measurements*, to which the student is referred.

The following rules of precision are given:

1. When a rejected figure is five or over, increase the previous figure by one.

If we decide to drop the 7 in 14.637, we should write it 14.64.

- 2. In the deviation measure, we should retain two significant figures. Thus a.d. = 0.062; r = 1.6.
- 3. In our measured quantity, we should retain places corresponding to the second significant figure in the deviation measure.

$$m = 368.731 \pm 0.21$$
 becomes 368.73,  $m = 406.67 \pm 2.6$  becomes 406.7.

4. In adding quantities, retain such places as correspond to the number having the largest deviation measure.

Quantity.	a.d.	Result.
374 20	0.36	374.20
4768.121	0.012	4768.12
984.1698	0.0021	984 17
		2122 12
		6126.49

5. In multiplication and division, find the quantity whose  $\frac{a.d.}{m}$  is the greatest. From this find the percentage precision and if this is 1 per cent or more, use four significant figures; if between 1 and 0.1 per cent use five significant figures; if between 0.1 and 0.01 per cent, use six significant figures.

If we have to multiply  $41.6\pm0.4$  by  $590.25\pm0.06$ , we note that  $\frac{a.d.}{m}$  is greater for the first than for the second. As this is less than 1 per cent, we should retain five significant figures, giving 24556 as a result.

#### PROBLEMS

- 1. We have given the number 504.628 with the following deviation measures: A.D.=0.21; r=0.031; correct to one part in one hundred; correct to two per cent. What is the proper expression for the number in each case?

  2. Add
  - $21.42 \pm 0.61$  $338.161 \pm 0.042$
  - 3. Multiply

 $630.45\pm0.62$  by  $25.635\pm0.024$ .

543.1 + 1.5

#### CHAPTER VIII

#### EMPIRICAL FORMULAE AND CONSTANTS

Definitions. A mathematical formula is one that is deduced by a process of reasoning along mathematical lines. The formula for the distance passed over the a falling body is an illustration.

 $S = v_0 t + \frac{1}{2}at^2$  is derived from certain definitions of velocity and acceleration, to which mathematical processes have been applied.

An empirical formula cannot be derived in this manner, but depends upon the results of experiments which are treated in a manner to be described. The following is a typical empirical formula:


$$q = 980.6056 - 2.5028 \cos 2l - 0.000003h$$
.

This has been made up from a large number of measurements of g under various conditions of latitude (l) and altitude (h).

In order to explain the method employed in constructing empirical formulae, let us take an experiment illustrating the relation of the space passed over by a falling body, to the time of fall. The following may be assumed to be the results of the experiment:

i	
1	1
2	4
3	9
4	16

The obvious relation existing between t and s will be disregarded, and we will endeavor to find an empirical

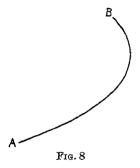

formula which fits the conditions. Our first step is to plot a curve.

This is seen to have the characteristics of a parabola and we write the general equation,

$$y = S + Tx + Ux^2 +$$
, etc.

x has been substituted for t, and y for s. From this are found observation equations:

$$1=S+T+U$$
  
 $4=S+2T+4U$   
 $9=S+3T+9U$   
 $16=S+4T+16U$ 

The normal equations are:

$$30=4S+10T+30U$$
  
 $100=10S+30T+100U$   
 $354=30S+100T+354U$ 

When these equations are solved, we have

$$U=1$$
 $T=0$ 
 $S=0$ 

and our equation becomes  $y = x^2$ .

If the experimenter had used only three seconds and had recorded an 8 instead of a 9, the values would have been

$$U = 0.5$$
  
 $T = 1.5$   
 $S = -1.0$ 

Giving 
$$y = -1 + 1.5x + 0.5x^2$$
.

Upon repeating the experiment as the space measurement approaches closer to 9 this formula approaches the value  $y=x^2$ .

While no one would think of actually applying this method to so simple a case, it affords a good illustration of the manner in which all empirical formulae are constructed

Classes of Curves. The following are some of the common curves from which these formulae may be constructed, together with their formulae and illustrations:

- 1. Straight line. x=y.
- 2. Parabolic. y=S+Tx+Ux+, etc.
- 3. Cyclic.  $y = S + T \sin \frac{2\pi}{m} x + T' \cos \frac{2\pi}{m} x + \text{, etc.}$
- 4. Logarithmic.  $y = be^{ax}$ .
- 5. Hyperbolic. xy = a.

The formula for velocity due to gravity, v=gt, illustrates the first class. The space passed over by a falling body, the change in velocity of a river below its surface, and the growth of the United States in population, illustrate the second class. Cyclic curves may be used to represent the rise and fall of temperature, pressure, and humidity through a given interval. The logarithmic curve represents plots made from Newton's law of cooling, the absorption of light for varying thicknesses, and the gain due to compound interest. A familiar example of a hyperbolic curve is afforded by Boyle's law, pv=ct. This will plot a rectangular hyperbola.

Rules. The method of procedure may be summarized in the following rules:

- 1. Write the observation equation.
- 2. Plot the curve.

- 3. Identify the curve and write its equation.
- 4. Form the normal equations.
- 5. Solve for the unknowns, and these give the values of the constants sought.

It will be observed that every additional observation taken alters the values of the constants.

#### **EXERCISES AND PROBLEMS**

For the straight line and rectangular hyperbola an inspection of the data is generally sufficient to determine the value of the constant.

For the parabola the following examples should be studied:

1. Vertical velocity curve on the Mississippi river.

Depth.	Velocity
$0.0\mathrm{depth}$	3.1950 feet per second
0.1	3.2299
0.2	3.2532
0.3	3.2611
0.4	3.2516
0.5	3.2282
0.6	3.1807
0.7	3.1266
0.8	3.0594
0.9	2.9759

The curve is obviously a parabola.

The first two observation equations are

$$3.1950 = S + 0.0T + 0.00U$$
,  
 $3.2299 = S + 0.1T + 0.01U$ .

Write down the remaining eight observation equations, form the normals, and solve. The results are

$$S=3.19513$$
  
 $T=0.44253$   
 $U=-0.7653$ , giving the formula  
 $Y=3.19513+0.44253X-0.7653X^2$ .



Frg 9.

It will prove of interest to determine the velocity for each depth and compare with that obtained by experiment. (Why should they fail to check?)

2. The growth in the population of the United States is a good illustration of this curve, although from the nature of the case the results are not very reliable. In *Popular Science Monthly* for April, 1910, page 382, a set of curves are drawn for various countries. It will be seen that Sweden and Norway, Turkey, Spain, and Italy may be fairly represented by straight lines. The United States shows an

easily recognized parabola. In the article referred to the complete solution of the census problem is given.

3. The following illustrates a cyclic curve:

в	Y	в	Y
0°	20	200°	14
20	38	220	-13
40	51	240	-24
60	64	260	$-24 \\ -30$
80	68	280	-28 -24 -13
100	70	300	-24
120	64	320	-13
140	53	340	- 2
160	16	360	20
180	20		-

Substitute  $\theta$  for  $\frac{2\pi}{m}x$  in the equation and plot the curve.

Use the first three terms and form an observation equation for each value of  $\theta$ . We have for the first four observation equations:

$$20 = S + T \sin 0^{\circ} + T'$$
  
 $38 = S + T \sin 20^{\circ} + T' \cos 20^{\circ}$   
 $51 = S + T \sin 40^{\circ} + T' \cos 40^{\circ}$   
 $64 = S + T \sin 60^{\circ} + T' \cos 60^{\circ}$ 

Normal equations for S, T, and T' are formed from these and their solution supplies the values of the constants in the formula.

4. We may use Winkelmann's data showing the rela-

tion between the temperature of a cooling body at different times, as an illustration of a logarithmic curve.

θ	$t_2 - t_1$
18 9	3 45
1,6 9	10 85
14.9	19 30
12 9	28 80
10 9	40.10
8 9	53.75
6.9	•0.95

The logarithmic relations of these quantities is not obvious by direct inspection. It is reached by the following process: We assume that the ratio at which a body loses heat (-dQ) is proportional to the difference between its temperature and that of its surroundings. This is expressed by

$$-\frac{dQ}{dt} = k(\theta - \theta_0).$$

By definition of specific heat

$$Q = sd\theta$$
.

Substitute this in the equation above

$$-\frac{d\theta}{dt} = a\theta$$
, where  $a = \frac{k}{s}$  and  $\theta_0 = 0$ .

From this we get by integrating

$$\log b - \log \theta = at$$
.

Now if  $\theta_1$  represents temperature at time  $t_1$ , and  $\theta_2$  temperature at time  $t_2$ , we have

$$\log b - \log \theta_1 = at_1;$$
  
 $\log b - \log \theta_2 = at_2;$ 

From which

$$a = \frac{1}{t_2 - t_1} \log \frac{\theta_2}{\theta_1}.$$

Take  $\theta_2 = 19.9$  and substitute the values of  $\theta$  for  $\theta_1$  and show that a is a constant, approximately equal to 0.0065.

Such an equation as  $-\frac{d\theta}{dt} = a\theta$ , where the change in a quantity is proportional to the quantity itself, is called a "compound interest equation."

### INDEX

	PAGE
Adjustment of Observations	22
Approximate Squares and Square Roots	
Arithmetical Mean	17
Average Deviation	42
Average Deviation	56
Chauvenet's Criterion	72
Constant Interval	17
Constants in an Equation	60
Empirical Formulae and Constants	
Errors—Classes of	3
Fractional Method	54
Huge Error	71
Least Squares	16
Mean Square Error	
Measurements—Classes of	2
Negligibility	67
Normal Equations	24
Plotting	58
Precision of Observations	
Probable Error	42
Probability	4
Probability Curve	9
Probability Integral	14
Propagation of Errors	
Propagation of Errors—Converse Problem	
Residuals	
Short Methods of Adjustment	34
Significant Figures	
Slide Rule	
Value of $\pi$	70
Weighting	18

# D. VAN NOSTRAND COMPANY 25 PARK PLACE NEW YORK

## SHORT-TITLE CATALOG

OF

## Publications & Importations

OF

## SCIENTIFIC AND ENGINEERING BOOKS



This list includes all the books published by the M. C. CLARK PUBLISHING CO., Chicago, Ill.,

and the technical publications of the following English publishers:

SCOTT, GREENWOOD & CO.

CONSTABLE & COMPANY, Ltd.

ELECTRICIAN PRINTING & PUBLISHING CO.

for whom D. Van Nostrand Company are American agents

Descriptive Circulars sent on request.

## SHORT-TITLE CATALOG

OF THE

## **Publications and Importations**

0P

## D. VAN NOSTRAND COMPANY

#### 25 PARK PLACE

The books published by the MYRON C. CLARK PUBLISHING CO., Chicago, III. are included in this catalog.

Prices marked with an asterisk (\*) are NET All bindings are in cloth unless otherwise noted

Abbott, A. V. The Electrical Transmission of Energy 8vo,	*\$5	00
—— A Treatise on Fuel. (Science Series No. 9.) 16mo,	0	50
—— Testing Machines. (Science Series No. 74.) . 16mo,		50
Adam, P. Practical Bookbinding. Trans. by T. E. Maw. 12mo,	*2	50
Adams, H. Theory and Practice in Designing 8vo,		50
Adams, H. C. Sewage of Seacoast Towns 8vo,	*2	00
Adams, J. W. Sewers and Drains for Populous Districts 8vo,	2	50
Adler, A. A. Theory of Engineering Drawing 8vo,	*2	00
Principles of Parallel Projecting-Line Drawing 8vo,	*1	00
Aikman, C. M. Manures and the Principles of Manuring 8vo,	2	50
Aitken, W. Manual of the Telephone 8vo,	*8	00
d'Albe, E. E. F. Contemporary Chemistry	*1	25
Alexander, J. H. Elementary Electrical Engineering 12mo,	2	00

Allan, W. Strength of Beams under Transverse Loads.	
(Science Series No 19.) 16mo,	9 50
Allan, W. Theory of Arches. Science Series No. 11.) . 16mo,	
Allen, H. Modern Power Gas Producer Practice and Applica-	
tions	*2 50
Anderson, J. W. Prospector's Handbook12mo,	1 50
Andes, L. Vegetable Fats and Oils8vo,	*4 00
— Animal Fats and Oils. Trans. by C. Salter8vo,	*4 00
Drying Oils, Boiled Oil, and Solid and Liquid Driers 8vo,	*5 00
- Iron Corrosion, Anti-fouling and Anti-corrosive Paints.	5 .
Trans. by C. Salter8vo,	*4 00
Oil Colors and Printers' Ink. Trans. by A. Morris and	•
H. Robson	*2 50
Treatment of Paper for Special Purposes. Trans. by C.	
Salter12m0,	*2 50
Andrews, E. S. Reinforced Concrete Construction12mo,	*1 25
— Theory and Design of Structures	3 50
Further Problems in the Theory and Design of Struc-	5 5-
tures8vo,	2 50
— The Strength of Materials 8vo,	*4 00
Andrews, E. S., and Heywood, H. B. The Calculus for	4 ***
Engineers	1 25
Annual Reports on the Progress of Chemistry. Twelve Vol-	Ū
umes now ready. Vol. I, 1904, to Vol. XII, 1914, 8vo,	
each	*2 00
Argand, M. Imaginary Quantities. Translated from the French	
by A. S. Hardy. (Science Series No. 52.) 16mo,	0 50
Armstrong, R., and Idell, F. E. Chimneys for Furnaces and	
Steam Boilers. (Science Series No. 1.) 16mo,	0 50
Arnold, E. Armature Windings of Direct Current Dynamos.	
Trans. by F. B. DeGress8vo,	*2 00
Asch, W., and Asch, D. The Silicates in Chemistry and	
Commerce	*6 00
Ashe, S. W., and Keiley, J. D. Electric Railways. Theoreti-	
cally and Practically Treated. Vol. I. Rolling Stock	
12mo,	*2 50
+ 2 m 0 j	٠,٠

Ashe, S. W. Electric Railways. Vol. II. Engineering Pre-	*-	
liminaries and Direct Current Sub-Stations 12mo,  —— Electricity: Experimentally and Practically Applied.	*2	
ramo	*2	00
Ashley, R. H. Chemical Calculations12mo,	*2	00
Atkins, W. Common Battery Telephony Simplified 12mo,	*1	25
Atkinson, A. A. Electrical and Magnetic Calculations. 8vo,	*1	50
Atkinson, J. J. Friction of Air in Mines. (Science Series		
No. 14.) . 16mo,	0	50
Atkinson, J. J., and Williams, E. H., Jr. Gases Met with in		-
Coal Mines. (Science Series No. 13.) 16mo,	0	50
Atkinson, P. The Elements of Electric Lighting12m0,		00
The Elements of Dynamic Electricity and Magnetism. 12mo,	2	00
Atkinson, P. Power Transmitted by Electricity12mo,	2	00
Auchincloss, W. S. Link and Valve Motions Simplified 8vo,	*1	50
Austin, E. Single Phase Electric Railways	*5	00
Ayrton, H. The Electric Arc8vo,	*5	00
Bacon, F. W. Treatise on the Richards Steam-Engine Indica-		
tor12m0,	I	00
Bailes, G. M. Modern Mining Practice. Five Volumes. 8vo, each,		50
Bailey, R. D. The Brewers' Analyst8vo,	*5	-
Baker, A. L. Quaternions 8vo,	*1	
—— Thick-Lens Optics 12mo,	*1	
Baker, Benj. Pressure of Earthwork. (Science Series No. 56.)		
16то,		
Baker, G. S. Ship Form, Resistance and Screw Propulsion,		
8vo,	*4	50
Baker, I.O Levelling. (Science Series No. 91.) 16mo,	0	50
Baker, M. N. Potable Water. (Science Series No. 61) 16mo,	0	50
Sewerage and Sewage Purification. (Science Series No. 18.)		
16mo,	0	50
Baker, T. T. Telegraphic Transmission of Photographs.		
12mo,	*1	25
Bale, G. R. Modern Iron Foundry Practice. Two Volumes.		
I2mo.		
Vol. I. Foundry Equipment, Material Used	*2	50
Vol. II. Machine Moulding and Moulding Machines.	* 1	50

Ball, J. W. Concrete Structures in Railways8vo,	*2	50
Ball, R. S. Popular Guide to the Heavens8vo,	*4	50
Natural Sources of Power. (Westminster Series)8vo,	*2	00
Ball, W. V. Law Affecting Engineers8vo,	*3	50
Bankson, Lloyd. Slide Valve Diagrams. (Science Series No.		
108.)	0	50
Barba, J. Use of Steel for Constructive Purposes12mo,	1	00
Barham, G. B. Development of the Incandescent Electric Lamp 8vo	*2	00
Barker, A. F. Textiles and Their Manufacture. (Westminster		
Series)	2	00
8vo,	3	00
Barker, A. H Graphic Methods of Engine Design 12mo,	*1	50
— Heating and Ventilation 4to,	*8	00
Barnard, J. H. The Naval Militiaman's Guide 16mo, leather,	1	00
Barnard, Major J. G. Rotary Motion. (Science Series No. 90.)		
16mo,	0	50
Barrus, G. H. Boiler Tests8vo,		00
—— Engine Tests8vo,	-	00
The above two purchased together	•	00
Barwise, S. The Purification of Sewage12mo,	3	50
Baterden, J. R. Timber. (Westminster Series)8vo,	*2	00
Bates, E. L., and Charlesworth, F. Practical Mathematics and		
Geometry12m0,		
Part I. Preliminary and Elementary Course	*1	50
Part II. Advanced Course		50
— Practical Mathematics 12mo,	*1	50
Practical Geometry and Graphics12mo,	*2	00
Batey, J. The Science of Works Management 12mo,	*I	25
Steam Boilers and Combustion	*1	25
Beadle, C. Chapters on Papermaking. Five Volumes. 12mo, each,	*2	00
Beaumont, R. Color in Woven Design 8vo,	*6	00
—— Finishing of Textile Fabrics		00
Standard Cloths 8vo,	*5	oó
Beaumont, W. W. Steam-Engine Indicator 8vo,	2	50

Bechhold, H. Colloids in Biology and Medicine. Trans. by J. G.		
Bullowa (In P	res	s.)
Beckwith, A. Pottery8vo, paper,	0	60
Bedell, F., and Pierce, C. A. Direct and Alternating Current		
Manual8vo,	<sup>*</sup> 2	oc
Beech, F. Dyeing of Cotton Fabrics8vo, *	<b>'</b> 3	00
	<sup>k</sup> 3	50
Beggs, G. E. Stresses in Railway Girders and Bridges (In $P$	res	s.)
Begtrup, J. The Slide Valve	'2	00
Bender, C. E. Continuous Bridges. (Science Series No. 26.)		
16mo,	0	50
Proportions of Pins used in Bridges. (Science Series No. 4.)		
16mo,		50
Bengough, G. D. Brass. (Metallurgy Series) (In Pr	es	s)
Bennett, H.G. The Manufacture of Leather8vo,	4	50
Bernthsen, A. A Text-book of Organic Chemistry. Trans. by		
	'2	50
Bersch, J. Manufacture of Mineral and Lake Pigments. Trans.		
	<b>'</b> 5	00
Bertin, L. E. Marine Boilers. Trans. by L. S. Robertson 8vo,		00
- · ·		00
	_	00
	۲7	50
•		00
•		25
	*I	50
	<sup>*</sup> 4	00
Blasdale, W. C. Quantitative Chemical Analysis. (Van		
		50
	<sup>*</sup> 6	00
Bloch, L. Science of Illumination. (Trans. by W. C.		
Clinton)8vo, *		50
	'I	25
Blucher, H. Modern Industrial Chemistry. Trans. by J. P.		
Millington 8vo, *	<sup>k</sup> 7	50
Blyth, A. W. Foods: Their Composition and Analysis 8vo,	7	50
Poisons; Their Effects and Detection8vo.	7	50

Delege B 0.351.11		
Bockmann, F. Celluloid	*2	50
Bodmer, G. R. Hydraulic Motors and Turbines12mo,	5	00
Boileau, J. T. Traverse Tables8vo,	5	00
Bonney, G. E. The Electro-plater's Handbook		20
Booth, N. Guide to Ring-Spinning Frame12mo,	*1	25
Booth, W. H. Water Softening and Treatment8vo,	*2	50
Superheaters and Superheating and their Control . 8vo,	*1	50
Bottcher, A. Cranes: Their Construction, Mechanical Equip-		
ment and Working. Trans. by A. Tolhausen 4to,	*10	00
Bottler, M. Modern Bleaching Agents. Trans. by C. Salter.		
12m0,	*2	50
Bottone, S. R. Magnetos for Automobilists12mo,	*1	-
Boulton, S. B. Preservation of Timber. (Science Series No.		
82.)16m0,	0	50
Bourcart, E. Insecticides, Fungicides and Weedkillers8vo,	*4	-
Bourgougnon, A. Physical Problems. (Science Series No. 113.)	7	J-
16mo,	0	50
Bourry, E. Treatise on Ceramic Industries. Trans. by	Ĭ	Ju
A. B. Searle	*=	00
Bowie, A. J., Jr. A Practical Treatise on Hydraulic Mining. 8vo,	_	00
	3	00
Bowles, O. Tables of Common Rocks. (Science Series,	_	
No. 125)		50
Bowser, E. A. Elementary Treatise on Analytic Geometry.12mo,	I	75
Elementary Treatise on the Differential and Integral		
Calculus	2	25
Bowser, E. A. Elementary Treatise on Analytic Mechanics,		
12 <b>m</b> 0,	_	00
Elementary Treatise on Hydro-mechanics 12mo,		50
A Treatise on Roofs and Bridges		25
Boycott, G. W. M. Compressed Air Work and Diving8vo,	*4	
Bragg, E. M. Marine Engine Design12mo,	*2	00
— Design of Marine Engines and Auxiliaries	*3	00
Brainard, F. R. The Sextant. (Science Series No. 101.).16mo,		
Brassey's Naval Annual for 1915. War Edition8vo,	4	00
Briggs, R., and Wolff, A. R. Steam-Heating. (Science Series	100	; \$P9
No. 67.)	0	50

Bright, C. The Life Story of Sir Charles Tilson Bright .8vo,	<sup>1</sup> 4 50
Brislee, T. J. Introduction to the Study of Fuel. (Outlines	
of Industrial Chemistry.) 8vo,	*3 oc
Broadfoot, S. K. Motors Secondary Batteries. (Installation	
Manuals Series.)	*o 75
Broughton, H. H. Electric Cranes and Hoists	*9 oc
Brown, G. Healthy Foundations. (Science Series No. 80.).16mo,	0 50
Brown, H. Irrigation8vo,	*5 00
Brown, H. Rubber8vo,	<sup>‡</sup> 2 00
Brown, Wm. N. The Art of Enamelling on Metal12mo,	*I 00
Handbook on Japanning 12mo,	*1 50
House Decorating and Painting 12m0,	*1 50
History of Decorative Art	*1 25
Dipping, Burnishing, Lacquering and Bronzing Brass	
Ware12m0,	*I 00
Workshop Wrinkles 8vo,	* I 00
Browne, C. L. Fitting and Erecting of Engines 8vo,	<sup>‡</sup> I 50
Browne, R. E. Water Meters. (Science Series No. 81.).16mo,	0 50
Bruce, E. M. Pure Food Tests 12mo,	*1 25
Bruhns, Dr. New Manual of Logarithms 8vo, cloth,	2 00
Half morocco,	2 50
Brunner, R. Manufacture of Lubricants, Shoe Polishes and	
Leather Dressings. Trans. by C. Salter 8vo,	*3 00
Buel, R. H. Safety Valves. (Science Series No. 21.) . 16mo,	0 50
Burley, G. W. Lathes, Their Construction and Operation,	
12m0,	I 25
Burnside, W. Bridge Foundations12mo,	*1 25
Burstall, F. W. Energy Diagram for Gas. With text8vo,	1 50
Diagram sold separately	*1 00
Burt, W. A. Key to the Solar Compass16mo, leather,	2 50
Buskett, E. W. Fire Assaying	*1 25
Butler, H. J. Motor Bodies and Chasis 8vo,	*2 50
Byers, H. G., and Knight, H. G. Notes on Qualitative	- 50
Analysis	*T 50

Cain, W. Brief Course in the Calculus12mo,	
Elastic Arches. (Science Series No. 48.)16mo,	*1 75
— Maximum Stresses. (Science Series No. 38.)16mo,	0 50
— Practical Disgning Retaining of Walls. (Science Series	0 50
No. 3.)	0 50
Theory of Steel-concrete Arches and of Vaulted Struc-	
tures. (Science Series, No. 42) 16mo,	0 50
Theory of Voussoir Arches. (Science Series No. 12.)	
16mo,	0 50
— Symbolic Algebra. (Science Series No. 73.) 16mo,	o <u>5</u> 0
Carpenter, F. D. Geographical Surveying. (Science Series	
No. 37.)	
Carpenter, R. C., and Diederichs, H. Internal-Combustion	
Engines	*5 00
Carter, H. A. Ramie (Rhea), China Grass	*2 00
Carter, H. R. Modern Flax, Hemp, and Jute Spinning 8vo,	*3 00
Bleaching, Dyeing and Finishing of Fabrics 8vo,	*1 00
Cary, E. R. Solution of Railroad Problems With the Use of	
the Slide Rule 16mo,	*1 00
Casler, M. D. Simplified Reinforced Concrete Mathematics,	s.
Cathcart, W. L. Machine Design. Part I. Fastenings 8vo,	*1 00 *3 00
Cathcart, W. L, and Chaffee, J. I. Elements of Graphic	3 00
Statics	*3 00
— Short Course in Graphics	I 50
Caven, R. M., and Lander, G. D. Systematic Inorganic Chem-	1 50
1stry 12mo,	*2 00
Chalkley, A. P. Diesel Engines8vo,	*3 50
Chambers' Mathematical Tables8vo,	I 75
Chambers, G. F. Astronomy16mo,	*1 50
Chappel, E. Five Figure Mathematical Tables8vo,	*2 00
Charnock. Mechanical Technology8vo,	*3 00
Charpentier, P. Timber8vo,	*6.00
Chatley, H. Principles and Designs of Aeroplanes. (Science	( , 4 ,
Series.)	0 50
Series.)	0 50 *1 <b>6</b> 0
How to Use Water Power	-

## 10 D. VAN NOSTRAND COMPANY'S SHORT-TITLE CATALOG

Child, C. D. Electric Arcs 8vo,	*2	00
Christian, M. Disinfection and Disinfectants. Trans. by		
Chas Salter 12m0,	2	00
Christie, W. W. Boiler-waters, Scale, Corrosion, Foaming,		
8vo,	*3	00
— Chimney Design and Theory 8vo,	*3	
Furnace Draft. (Science Series, No. 123) 16mo,		50
Water, Its Purification and Use in the Industries8vo,		00
Church's Laboratory Guide. Rewritten by Edward Kinch 8vo,		50
Clapperton, G. Practical Papermaking8vo,	2	50
Clark, A. G. Motor Car Engineering.		
Vol. I. Construction	<sup>*</sup> 3	00
Vol. II. Design (In I	Pres	s.)
Clark, C. H. Marine Gas Engines		
Clark, J. M. New System of Laying Out Railway Turnouts,		
12m0,	I	00
Clarke, J. W., and Scott, W. Plumbing Practice.		
Vol. I. Lead Working and Plumbers' Materials 8vo,	*4	00
Vol. II. Sanitary Plumbing and Fittings (In 1		
Vol. III. Practical Lead Working on Roofs(In 1	Pres	s)
Clarkson, R. B. Elementary Electrical Engineering.		
(In I	Pres	s)
Clausen-Thue, W. A B C Universal Commercial Telegraphic	_	
Code. Sixth Edition(In I	res	s)
Clerk, D., and Idell, F. E. Theory of the Gas Engine.		
(Science Series No. 62.)	0	50
Clevenger, S. R. Treatise on the Method of Government		
Surveying		50
Clouth, F. Rubber, Gutta-Percha, and Balata 8vo,	_	00
Cochran, J. Treatise on Cement Specifications8vo,	*1	
Concrete and Reinforced Concrete Specifications 8vo,	*2	
Cochran, J. Inspection of Concrete Construction8vo,	*4	
Coffin, J. H. C. Navigation and Nautical Astronomy12mo,	*3	50
Colburn, Z., and Thurston, R. H. Steam Boiler Explosions.		
(Science Series No. 2.) 16mo,	0	_
Cole. R. S. Treatise on Photographic Optics	т	50

Coles-Finch, W. Water, Its Origin and Use 8vo,	*5	00
Collins, J. E. Useful Alloys and Memoranda for Goldsmiths,		
Jewelers16mo,	0	50
Collis, A. G. High and Low Tension Switch-Gear Design 8vo,	*3	50
Switchgear. (Installation Manuals Series.) 12mo,	0	50
Comstock, D. F., and Troland, L. T. The Nature of Matter		
and Electricity (In P	res.	s.)
Coombs, H. A. Gear Teeth. (Science Series No. 120)16mo,	0	50
Cooper, W. R. Primary Batteries8vo,	*4	00
Copperthwaite, W. C. Tunnel Shields4to,		00
Corfield, W. H. Dwelling Houses. (Science Series No. 50.) 16mo,	0	50
— Water and Water-Supply. (Science Series No. 17.) . 16mo,		50
Cornwall, H. B. Manual of Blow-pipe Analysis8vo,		50
Cowee, G. A. Practical Safety Methods and Devices 8vo,	-	00
Cowell, W. B. Pure Air, Ozone, and Water	*2	00
Craig, J. W., and Woodward, W. P. Questions and Answers about Electrical Apparatusramo, leather,		50
Craig, T. Motion of a Solid in a Fuel. (Science Series No. 49.)	•	50
16mo.	٥	50
Wave and Vortex Motion. (Science Series No. 43.). 16mo,		50
Cramp, W. Continuous Current Machine Design 8vo,		50
Creedy, F. Single-Phase Commutator Motors8vo,		00
Crocker, F. B. Electric Lighting. Two Volumes. 8vo.		
Vol. I. The Generating Plant	3	00
Vol. II. Distributing Systems and Lamps	•	
Crocker, F B., and Arendt, M. Electric Motors8vo,	*2	50
- and Wheeler, S. S. The Management of Electrical Ma-		
chinery12mo,	*1	00
Cross, C. F., Bevan, E. J., and Sindall, R. W. Wood Pulp and		
Its Applications. (Westminster Series.)8vo,		00
Crosskey, L. R. Elementary Perspective8vo,		00
Crosskey, L. R., and Thaw, J. Advanced Perspective8vo,		50
Culley, J. L. Theory of Arches. (Science Series No. 87.) 16mo,	0	50
Cushing, H. C., Jr., and Harrison, N. Central Station Man-	*-	o o
agement		
Defourier H M Analytical Mechanics 8vo.	*,	000

Dana, R. T. Handbook of Construction Plant 12mo, leather,  Handbook of Construction Efficiency (In		00 (د
Danby, A. Natural Rock Asphalts and Bitumens8vo,		50
Davenport, C. The Book. (Westminster Series.)8vo,		00
Davey, N. The Gas Turbine	*4	00
Davies, F. H. Electric Power and Traction8vo,	*2	00
Foundations and Machinery Fixing. (Installation Manuals		
Series)		00
Deerr, N. Sugar Cane Trans by C. T. Ving. 4to.	-	00
Deite, C. Manual of Soapmaking. Trans. by S. T. King4to, De la Coux, H. The Industrial Uses of Water. Trans. by A.	. 5	00
Morris	*4	۳۸
Del Mar, W. A. Electric Power Conductors 8vo,	*2	
Denny, G. A. Deep-Level Mines of the Rand4to,	*10	
—— Diamond Drilling for Gold.	*5	
De Roos, J. D. C. Linkages. (Science Series No. 47.) 16mo,	-	50
Derr, W. L. Block Signal OperationOblong 12mo,	*1	50
Maintenance of Way Engineering (In Prepare	ratıo	n.)
Desaint, A. Three Hundred Shades and How to Mix Them.		
8v0,	8	00
De Varona, A. Sewer Gases. (Science Series No. 55.) . 16mo,	0	50
Devey, R. G. Mill and Factory Wiring. (Installation Manuals		
Series.)		00
		50
Dichman, C. Basic Open-Hearth Steel Process8vo,	*3	50
Dieterich, K. Analysis of Resins, Balsams, and Gum Resins	sk_	
Dilworth, E. C. Steel Railway Bridges4to,		00
Dinger, Lieut. H. C. Care and Operation of Naval Machinery	4	00
Dinger, Lieut. H. C. Care and Operation of Navar Machinery	*2	
Dixon, D. B. Machinist's and Steam Engineer's Practical Cal-	. 2	00
culator	τ.	25
Dodge, G. F. Diagrams for Designing Reinforced Concrete	•	-3
Structures	*,	00
Dommett, W. E. Motor Car Mechanism12mo,		25
Dorr, B. F. The Surveyor's Guide and Pocket Table-book.		-
16mo, mor.,	2	00

Draper, C. H. Elementary Text-book of Light, Heat and		
Sound	1	00
Draper, C. H. Heat and the Principles of Thermo-dynamics	•	
12mo,	2	00
Dron, R. W. Mining Formulas 12mo,	1	00
Dubbel, H. High Power Gas Engines8vo,		00
Dumesny, P., and Noyer, J. Wood Products, Distillates, and	•	
Extracts8vo,	*1	50
Duncan, W. G., and Penman, D. The Electrical Equipment of	7	J÷
Collieries8vo,	*4	00
Dunstan, A. E., and Thole, F. B. T. Textbook of Practical	4	•
Chemistry 12mo,	*1	40
Duthie, A. L. Decorative Glass Processes. (Westminster	•	40
Series)8vo,	*2	00
Dwight, H. B. Transmission Line Formulas8vo	*2	
Dyson, S. S. Practical Testing of Raw Materials 8vo,	*5	
and Clarkson, S. S. Chemical Works 8vo,	*7	
	•	J
Eccles, W. H. Wireless Telegraphy and Telephony12mo,	*4	
Eck, J. Light, Radiation and Illumination. Trans. by Paul	4	50
	Ψ.	
Hogner	*2	50
Eddy, H. T. Maximum Stresses under Concentrated Loads,		
8vo,	1	50
Eddy, L. C. Laboratory Manual of Alternating Currents,		
12m0,	0	50
Edelman, P. Inventions and Patents12mo	ķI	50
Edgcumbe, K. Industrial Electrical Measuring Instruments.		
870,		
Edler, R. Switches and Switchgear. Trans. by Ph. Laubach.		
8vo,	*4	00
Eissler, M. The Metallurgy of Gold8vo,		50
The Metallurgy of Silver8vo,	-	00
The Metallurgy of Argentiferous Lead8vo,		00
- A Handbook of Modern Explosives	_	00
Ekin, T. C. Water Pipe and Sewage Discharge Diagrams	J	
folio,	*3	00

Electric Light Carbons, Manufacture of 8vo, Eliot, C. W., and Storer, F. H. Compendious Manual of Qualita-	1	00
tive Chemical Analysis12mo, Ellis, C. Hydrogenation of Oils8vo,	*1	25
Ellis, G. Modern Technical Drawing8vo,	*2	oc
Ennis, Wm. D. Linseed Oil and Other Seed Oils8vo,	*4	00
—— Applied Thermodynamics8vo,	*4	50
—— Flying Machines To-day	*1	50
Vapors for Heat Engines	*1	00
— Vapors for Heat Engines	*2	00
Erwin, M. The Universe and the Atom12mo,	*2	00
Evans, C. A. Macadamized Roads(In	Pres	ss.)
Ewing, A. J. Magnetic Induction in Iron 8vo,	*4	
Fairie, J. Notes on Lead Ores	*1	00
—— Notes on Pottery Clays	*1	50
Fairley, W., and Andre, Geo. J. Vertilation of Coal Mines.		
(Science Series No. 58.) . 16mo,	0	50
Fairweather, W. C. Foreign and Colonial Patent Laws 8vo,	*3	00
Falk, M. S. Cement Mortars and Concretes 8vo,		50
Fanning, J. T. Hydraulic and Water-supply Engineering 8vo,	*5	00
Fay, I. W. The Coal-tar Colors 8vo,	*4	00
Fernbach, R. L. Glue and Gelatine8vo,	*3	
—— Chemical Aspects of Silk Manufacture12mo,	*1	
Firth, J. B. Practical Physical Chemistry 12mo,	*1	00
Fischer, E. The Preparation of Organic Compounds. Trans.		
by R. V. Stanford 12mo,	*1	25
Fish, J. C. L. Lettering of Working Drawings Oblong 8vo, ——Mathematics of the Paper Location of a Railroad,		00
Fisher, H. K. C., and Darby, W. C. Submarine Cable Testing.	*o	25
8vo,	*3	۲o
Fleischmann, W. The Book of the Dairy. Trans. by C. M.	3	54
Aikman	4	00
Fleming, J. A. The Alternate-current Transformer. Two	4	00
Volumes8vo.		
Vol. I. The Induction of Electric Currents	*_	
Vol. II. The Utilization of Induced Currents	*5 *5	
TOWAL AND ULINEARIUM OF THURDON CHILDRIS		oo

Fleming, J. A. Propagation of Electric Currents 8vo, *3 oo
— A Handbook for the Electrical Laboratory and Testing
Room. Two Volumes
Fleury, P. Preparation and Uses of White Zinc Paints 8vo, *2 50
Flynn, P. J. Flow of Water. (Science Series No. 84.) 12mo, 0 50
Hydraulic Tables. (Science Series No. 66.)16mo, o 50
Forgie, J. Shield Tunneling
Foster, H. A. Electrical Engineers' Pocket-book. (Seventh
Edition : 5 00
Engineering Valuation of Public Utilities and Factories,
870, *3 00
— Handbook of Electrical Cost Data 8vo. (In Press)
Fowle, F. F. Overhead Transmission Line Crossings 12mo, *1 50
— The Solution of Afternating Current Problems. 8vo (In Press)
Fox, W. G. Transition Curves. (Science Series No. 110.).16mo, o 50
Fox, W., and Thomas, C. W. Practical Course in Mechanical
Drawing 1250.
Foye, J. C. Chemical Problems. (Science Series No. 69.).16mo, 0 50
Toye, J. C. Chemical Problems. (Science Series No. 96.). 10mb, 0 50
—— Handbook of Mineralogy. (Science Series No. 86.) 16mo, o 50
Francis, J. B. Lowell Hydraulic Experiments 4to, 15 00
Franzen, H. Exercises in Gas Analysis 12mo, *1 00
French, J. W. Machine Tools. 2 vols 4to, *15 oo
Freudemacher, P. W. Electrical Mining Installations. (Installation Manuals Series.) 12mo, *1 00
Dullion Division in the state of the state o
Titul 1. Intornation 2
Fritsch, J. Manufacture of Chemical Manures. Trans. by
D. Grant 8vo, *4 00
Frye, A. I. Civil Engineers' Pocket-book 12mo, leather, *5 00
Fuller, G. W. Investigations into the Purification of the Ohio
River4to, *10 00
Furnell, J. Paints, Colors, Oils, and Varnishes8vo, *1 oo
Gairdner, J. W. I. Earthwork 8vo (In Press)
Gent I. W. Flements of Electric Traction8vo, *2 50
Garcia, A. J. R. V. Spanish-English Railway Terms 8vo, *4 50

Gallette, H. P., and Dana, R. T. Cost Keeping and Management Engineering8vo, *3 50
Gillmore, Gen. Q. A. Limes, Hydraulics Cement and Mortars.
8vo, 4 oc
Roads, Streets, and Pavements
Godfrey, E. Tables for Structural Engineers .16mo, leather, *2 50
Golding, H. A The Theta-Phi Diagram 12mo, *1 29
Goldschmidt, R. Alternating Current Commutator Motor 8vo, *3 od
Goodchild, W. Precious Stones. (Westminster Series.) 8vo, *2 od
Goodeve, T. M. Textbook on the Steam-engine12mo, 2 or
Gore, G. Electrolytic Separation of Metals 8vo, *3 50
Gould, E. S. Arithmetic of the Steam-engine 12mo, 1 of
Calculus. (Science Series No. 112.) 16mo, o 50
High Masonry Dams. (Science Series No. 22.)16mo, o 50
Practical Hydrostatics and Hydrostatic Formulas. (Science
Series No. 117.)
Gratacap, L. P. A Popular Guide to Minerals 8vo, *3 oc
Gray, J. Electrical Influence Machines 12mo, 2 00
Gray, J. Marine Boiler Design
Greenhill, G. Dynamics of Mechanical Flight 8vo. *2 5
Greenwood, E. Classified Guide to Technical and Commercial
Books
Gregorius, R. Mineral Waxes. Trans. by C. Salter . 12mo, *3 o
Grierson, R. Modern Methods of Ventilation (In Press.)
Griffiths, A. B. A Treatise on Manures 3 00
Griffiths, A. B. Dental Metallurgy8vo, *3 5
Gross, E. Hops8vo, *4 5
Grossman, J. Ammonia and its Compounds12mo, *1 2
Groth, L. A. Welding and Cutting Metals by Gases or Electricity. (Westminster Series.)8vo, *2 o
Grover, F. Modern Gas and Oil Engines
Gruner, A. Power-loom Weaving8vo, *3 o
Güldner, Hugo. Internal-Combustion Engines. Trans. by
77 Disdishe

Gunther, C. O. Integration 8vo,	*1	25
Gurden, R. L. Traverse Tables folio, half mor.,	*7	50
Guy, A. E. Experiments on the Flexure of Beams 8vo,	*1	25
Haenig, A. Emery and the Emery Industry 8vo,	*2	50
Hainbach, R. Pottery Decoration. Trans. by C. Salter 12mo,	*3	00
Hale, W. J. Calculations of General Chemistry 12mo,	*1	00
Hall, C. H Chemistry of Paints and Paint Vehicles 12mo,	*2	00
Hall, G. L. Elementary Theory of Alternate Current Work-	*-	
ing 8vo,	*1	-
Hall, R. H. Governors and Governing Mechanism. 12mo,	*2	00
Hall, W. S. Elements of the Differential and Integral Calculus	*2	
8vo,	*3	_
—— Descriptive Geometry 8vo volume and 4to atlas, Haller, G. F., and Cunningham, E. T. The Tesla Coil 12mo,	3 *1	
Halsey, F. A. Shde Valve Gears		50
The Use of the Slide Rule. (Science Series No. 114.)	-	J.
10MO,	0	50
Worm and Spiral Gearing. (Science Series No. 116.)		
16m0,		50
Hancock, H. Textbook of Mechanics and Hydrostatics. 8vo,		50
Hancock, W. C. Refractory Materials. (Metallurgy Series. (In I		
Hardy, E. Elementary Principles of Graphic Statics 12mo, Haring, H. Engineering Law.		50
Vol. I. Law of Contract 8vo,	*4	00
Harper, J. H. Hydraulic Tables on the Flow of Water 16mo,	*2	00
Harris, S. M. Practical Topographical Surveying (In 1	res	s)
Harrison, W. B. The Mechanics' Tool-book 12mo,	I	50
Hart, J. W. External Plumbing Work 8vo,	*3	00
Hints to Plumbers on Joint Wiping 8vo,	*3	00
Principles of Hot Water Supply8vo,		00
Sanitary Plumbing and Drainage 8vo,	*3	00
Haskins, C. H. The Galvanometer and Its Uses 16mo,		50
Hatt, J. A. H. The Colorist square 12mo,	*1	50
Hausbrand, E. Drying by Means of Air and Steam. Trans.		
by A. C. Wright 12mo,	*2	00
Evaporating, Condensing and Cooling Apparatus. Trans.	ı	
by A. C. Wright 8vo.	*5	00

Hausmann, E. Telegraph Engineering 8vo, Hausner, A. Manufacture of Preserved Foods and Sweetmeats.	` 3	00
Trans. by A. Morris and H. Robson 8vo,	3	00
Hawkesworth, J. Graphical Handbook for Reinforced Concrete		
Design 4to,	*2	50
<u>.</u> .	12	
Hayes, H. V. Public Utilities, Their Cost New and Deprecia-		•
tion 8vo,	*2	00
Public Utilities, Their Fair Present Value and Return,		
8vo,		
Heath, F. H. Chemistry of Photography 8vo (In F		
Heather, H. J. S. Electrical Engineering	*3	50
Vols. I and II 8vo, each,	*5	
Vol. III 8vo,	*7	
Heck, R. C. H. Steam Engine and Turbine 8vo,	*3	50
—— Steam-Engine and Other Steam Motors. Two Volumes.		
Vol. I. Thermodynamics and the Mechanics 8vo,	*3	
Vol. II. Form, Construction and Working 8vo,		00
Notes on Elementary Kinematics 8vo, boards,	*1	
—— Graphics of Machine Forces	*1	00
12mo,	* 2	50
Heidenreich, E. L. Engineers' Pocketbook of Reinforced Concrete		00
Hellot, Macquer and D'Apligny. Art of Dyeing Wool, Silk and	3	00
Cotton 8vo,	*2	00
Henrici, O. Skeleton Structures 8vo,	3	50
Hering, D. W. Essentials of Physics for College Students.		Ŭ
8vo,	*1	75
Hering-Shaw, A. Domestic Sanitation and Plumbing. Two		
$\nabla_{0}$ ls8 $\nabla_{0}$ ,	-	00
Elementary Science		00
Herington, C. F. Powdered Coal as a Fuel(In F	res	s)
Hermann, G. The Graphical Statics of Mechanism. Trans.		
by A. P. Smith		
Herzfeld, J. Testing of Yarns and Textile Fabrics8vo,	<i>™</i> 3	50

Hineprandi, A. Auships, Past and Procession	*3	50
Hildenbrand, B. W. Cable-Making. (Science Series No. 32.)		
16me,		
Hilditch, T. P. Concise History of Chemistry 12mo,	ſI	25
Hill, C. S. Concrete Inspection 16mo,	*1	00
Hill, C. W. Laboratory Manual and Notes in Beginning		
Chemistry(In P	res.	s.)
		,
Hill, J. W. The Purification of Public Water Supplies. New	-	
Edition (In I	Pre·	ss )
—— Interpretation of Water Analysis (In I	Pre	ss )
Hill, M. J. M. The Theory of Proportion8vo,	*2	50
Hiroi, I. Plate Girder Construction. (Science Series No. 95.)		
16mo,	0	50
Statically-Indeterminate Stresses 12mo,	*2	00
Hirshfeld, C. F. Engineering Thermodynamics. (Science		
Series No. 45)	Ω	50
Hoar, A. The Submarine Torpedo Boat		00
Hobart, H. M. Heavy Electrical Engineering 8vo,	*4	
Design of Static Transformers	*2	00
Electricity 8vo,	*2	00
Electric Trains 8vo,	*2	50
—— Electric Propulsion of Ships 8vo,	*2	00
Hobart, J. F. Hard Soldering, Soft Soldering, and Brazing.		
12m0,	*1	00
Hobbs, W. R. P. The Arithmetic of Electrical Measurements		
12mo,	0	50
Hoff, J. N. Paint and Varnish Facts and Formulas 12mo,	*1	
The Dietribution of Gas 840		50
Hole, W. The Distribution of Gas 8vo, Holley, A. L. Railway Practice folio,		00
Hopkins, N. M. Model Engines and Small Boats12mo,	I	25
Hopkinson, J., Shoolbred, J. N., and Day, R. E. Dynamic		
Electricity. (Science Series No. 71.). 16mo,	0	50
Horner, J. Practical Ironfounding8vo,	*2	00
Gear Cutting, in Theory and Practice 8vo,	*3	00
Houghton, C. E. The Elements of Mechanics of Materials 12mo,	*2	00
Houstoun, R. A. Studies in Light Production 12mo,		00

Hovenden, F. Practical Mathematics for Young Engineers,	
12m0, *1	00
Howe, G. Mathematics for the Practical Man 12mo, *1	25
Howorth, J. Repairing and Riveting Glass, China and Earthen-	
ware	
Hoyt, W. F. Chemistry by Experimentation(In Pres	s)
Hubbard, E. The Utilization of Wood-waste8vo, $*_2$	00
Hubner, J. Bleaching and Dyeing of Vegetable and Fibrous Materials. (Outlines of Industrial Chemistry.).8vo, *5	00
Hudson, O. F. Iron and Steel. (Outlines of Industrial Chemistry.) 8vo, *2	00
Humphrey, J. C. W. Metallography of Strain. (Metallurgy	•
Series)	ر ،
	3./
Humphreys, A. C. The Business Features of Engineering	
Practice	-
Hunter, A. Bridge Work	
Hurst, G. H. Handbook of the Theory of Color 8vo, *2	
—— Dictionary of Chemicals and Raw Products8vo, *3	
Lubricating Oils, Fats and Greases8vo, *4	
—— Soaps 8vo, *5	00
Hurst, G. H., and Simmons, W. H. Textile Soaps and Oils,	
<b>8</b> vo, 3	00
Hurst, H. E., and Lattey, R. T. Text-book of Physics8vo, *3	00
Also published in Three Parts:	
Vol. I. Dynamics and Heat*1	-
Vol. II. Sound and Light*1	•
k Vol. III. Magnetism and Electricity*1	50
Hutchinson, R. W., Jr. Long Distance Electric Power Trans-	
mission 12mo, *3	60
mission 12mo, *3 Mutchinson, R. W., Jr., and Thomas, W. A. Electricity in	
Mining(In Pres.	s.)
Hutchinson, W. B. Patents and How to Make Money Out of	
	25
Hutton, W. S. The Works' Manager's Handbook 8vo, 6	00
	50
Tyde, F. S. Solvents, Oils, Gums and Waxes8vo, *2	00

Induction Coils. (Science Series No. 53.) 16mo, Ingham, A. E. Gearing. A practical treatise		50
Ingham, A. E. Gearing. A practical treatise 8vo,		50
Ingle, H. Manual of Agricultural Chemistry. 8vo,	_	00
Inness, C. H. Problems in Machine Design12mo,	*2	00
- Air Compressors and Blowing Engines 12mo,	*2	00
Centrifugal Pumps	*2	00
— The Fan 12mo,	*2	00
Ivatts, E. B. Railway Management at Stations 8vo,	*2	50
Jacob, A., and Gould, E. S. On the Designing and Construction		
of Storage Reservoirs. (Science Series No. 6.)16mo,	0	50
Jannettaz, E. Guide to the Determination of Rocks. Trans.		-
by G. W. Plympton	I	50
Jehl, F. Manufacture of Carbons	*4	00
Jennings, A. S. Commercial Paints and Painting. (West-		
minster Series.)8vo,	*2	00
Jennison, F. H. The Manufacture of Lake Pigments 8vo,	*.3	00
Jepson, G. Cams and the Principles of their Construction 8vo,	*1	50
— Mechanical Drawing 8vo (In Prepar		_
Jervis-Smith, F. J. Dynamometers8vo,	*3	
Jockin, W. Arithmetic of the Gold and Silversmith 12mo,	*1	00
Johnson, J. H. Arc Lamps and Accessory Apparatus. (In-		
stallation Manuals Series.)12mo,	*o	75
Johnson, T. M. Ship Wiring and Fitting. (Installation		
Manuals Series.)	*0	
Johnson, W. McA. The Metallurgy of Nickel(In Prepar	atro	n)
Johnston, J. F. W., and Cameron, C. Elements of Agricultural		
Chemistry and Geology 12mo,	2	60
Chemistry and Geology 12mo, Joly, J. Radioactivity and Geology 12mo,	*3	00
Jones, H. C. Electrical Nature of Matter and Radioactivity		
12mo,	*2	00
— Nature of Solution(In P	ress	:.)
New Era in Chemistry 12mo,	*2	00
Jones, J. H. Tinplate Industry8vo,	*3	00
Jones, M. W. Testing Raw Materials Used in Paint 12mo,	*2	00
Jordan, L. C. Practical Railway Spiral12mo, Leather,	*1	
· · · · · · · · · · · · · · · · · · ·		-

Joynson, F. H. Designing and Construction of Machine Gear-		
ing	2	00
Jüptner, H. F. V. Siderology: The Science of Iron 8vo,	*5	00
Kapp, G. Alternate Current Machinery. (Science Series No.		
96.)	0	50
	*4	00
Keim, A. W. Prevention of Dampness in Buildings 8vo,	*2	00
Keller, S. S. Mathematics for Engineering Students.		
12mo, half leather,		
Algebra and Trigonometry, with a Chapter on Vectors	*1	フェ
—— Plane and Solid Geometry.	*1	
and Knox, W. E. Analytical Geometry and Calculus		~5 00
Kelsey, W. R. Continuous-current Dynamos and Motors.	~	•
8yo.	*~	50
Kemble, W. T., and Underhill, C. R. The Periodic Law and the		50
	*-	
Hydrogen Spectrum 8vo, paper,	*0	-
Kemp, J. F. Handbook of Rocks 8vo,		50
Kendall, E. Twelve Figure Cipher Code 4to,	*12	50
Kennedy, A. B. W., and Thurston, R. H. Kinematics of		
Machinery. (Science Series No. 54.) 16mo,	0	50
Kennedy, A. B. W., Unwin, W. C., and Ideil, F. E. Compressed		
Air. (Science Series No. 106.) 16mo,		50
Kennedy, R. Modern Engines and Power Generators. Six		
Volumes	15	00
Single Volumes each,	3	00
Electrical Installations. Five Volumes	15	oo
Single Volumes each,		50
Flying Machines; Practice and Design 12mo,	_	00
Principles of Aeroplane Construction		50
Kennelly, A. E. Electro-dynamic Machinery 8vo,		50
Kent, W. Strength of Materials. (Science Series No. 41.).16mo,		50
Kershaw, J. B. C. Fuel, Water and Gas Analysis 8vo,	*2	-
Electrometallurgy. (Westminster Series.) 8vo,	*2	
The Electric Furnace in Iron and Steel Production. 12mo,		50
Electro-Thermal Methods of Iron and Steel Production,	•	Şυ
8vo,	*3	00
Kindelan I Trackman's Helper 12mo.	3	

## 24 D. VAN NOSTRAND COMPANY'S SHORT-TITLE CATALOG

Kinzbrunner, C. Alternate Current Windings 8vo,	*1	50
—— Continuous Current Armatures 8vo,	*1	50
Testing of Alternating Current Machines 8vo,	*2	00
Kirkaldy, A. W., and Evans, A. D. History and Economics		
of Transport 8vo,	*3	00
Kirkaldy, W. G. David Kirkaldy's System of Mechanical		
Testing	10	
Kirkbride, J. Engraving for Illustration 8vo,	*1	_
Kirkham, J. E. Structural Engineering8vo,	*5	oc
Kirkwood, J. P. Filtration of River Waters 4to,	7	50
Kirschke, A. Gas and Oil Engines		2
Klein, J. F. Design of a High speed Steam-engine 8vo,	*5	00
Physical Significance of Entropy 8vo,	*1	50
Klingenberg, G. Large Electric Power Stations4to,	*5	00
Knight, RAdm. A. M. Modern Seamanship8vo,	*7	50
Half Mor.	*9	00
Knott, C. G., and Mackay, J. S. Practical Mathematics 8vo,	2	oc
Knox, G. D. Spirit of the Soil	*1	25
Knox, J. Physico-chemical Calculations 12mo, ——Fixation of Atmospheric Nitrogen. (Chemical Mono-	*1	00
graphs.)12m0,	0	75
Koester, F. Steam-Electric Power Plants 4to,	*5	oc
Hydroelectric Developments and Engineering 4to,	*5	00
Koller, T. The Utilization of Waste Products8vo,	*3	oc
Cosmetics 8vo,	*2	50
	*2	
Kozmin, P. A. Flour Milling. Trans. by M. Falkner 8vo,		-
(In)	Pres	s.)
Kremann, R. Application of Physico Chemical Theory to		·
Technical Processes and Manufacturing Methods.		
Trans. by H. E. Potts8vo,	*2	50
Kretchmar, K. Yarn and Warp Sizing8vo,		
many and many orang,	4	00
Lallier, E. V. Elementary Manual of the Steam Engine.		
12m0,	*2	00
Lambert, T. Lead and its Compounds 8vo,		
Bone Products and Manures 8vo.	*3	

Lamborn, L. L. Cottonseed Products 8vo,	*,3	00
	*7	50
Lamprecht, R. Recovery Work After Pit Fires. Trans. by		
C. Salter 8vo,	*4	00
Lancaster, M. Electric Cooking, Heating and Cleaning8vo,		50
Lanchester, F. W. Aerial Flight. Two Volumes. 8vo.		
Vol. I. Aerodynamics	.*6	00
Vol. II. Aerodonetics		00
— The Flying Machine	Pres	s)
Lange, K. R. By-Products of Coal-Gas Manufacture. 12mo,		00
Larner, E. T. Principles of Alternating Currents 12mo,		25
La Rue, B. F. Swing Bridges. (Science Series No. 107.) 16mo,		50
Lassar-Cohn, Dr. Modern Scientific Chemistry. Trans. by M.	_	
M. Pattison Muir	*2	00
Latimer, L. H., Field, C. J., and Howell, J. W. Incandescent		
Electric Lighting. (Science Series No. 57.) 16mo,	0	50
Latta, M. N. Handbook of American Gas-Engineering Practice.		
8vo,	*4	50
American Producer Gas Practice 4to.	*6	
Laws, B. C. Stability and Equilibrium of Floating Bodies.8vo,		50
Lawson, W. R. British Railways, a Financial and Commer-	-	-
cial Survey 8vo,	2	00
Leask, A. R. Breakdowns at Sea 12mo,	2	00
Refrigerating Machinery	2	00
Lecky, S. T. S. "Wrinkles" in Practical Navigation 8vo,	*10	00
Le Doux, M. 1ce-Making Machines. (Science Series No. 46.)		
т6то,	0	50
Leeds, C. C. Mechanical Drawing for Trade Schools.oblong 4to,	*2	00
- Mechanical Drawing for High and Vocational Schools,		
4to,	*1	25
Lefévre, L. Architectural Pottery. Trans. by H. K. Bird and		
W. M. Binns 4to,	*7	50
Lehner, S. Ink Manufacture. Trans. by A. Morris and H		-
Robson	*2	50
Lemstrom, S. Electricity in Agriculture and Horticulture .8vo,	*1	
Lette E A Fundamental Problems in Chemistry 8va		00

Le Van, W. B. Steam-Engine Indicator. (Science Series No.		
78.) 16mo,	0	50
Lewes, V. B. Liquid and Gaseous Fuels. (Westminster Series.)		•
8vo,	*2	00
Carbonization of Coal 8vo,	*3	00
Lewis, L. P. Railway Signal Engineering 8vo,	*3	50
Licks, H. E. Recreations in Mathematics12mo,	I	25
Lieber, B. F. Lieber's Five Letter Standard Telegraphic Code,		
8vo,	*10	00
Spanish Edition	*10	00
French Edition8vo,	*10	00
— Terminal Index 8vo,	*2	50
Lieber's Appendix folio,		
Handy Tables 4to,		
Bankers and Stockbrokers' Code and Merchants and		
Shippers' Blank Tables	*15	00
Lieber, B. F. 100,000,000 Combination Code 8vo,	*10	00
Engineering Code	*12	
Livermore, V. P., and Williams, J. How to Become a Com-		-
petent Motorman 12mo,	*1	00
Livingstone, R. Design and Construction of Commutators 8vo,	*2	25
- Mechanical Design and Construction of Generators .8vo,	*3	50
Lloyd, S. L. Fertilizer Materials(In 1	Pres	s)
Lobben, P. Machinists' and Draftsmen's Handbook 8vo,	2	50
Lockwood, T. D. Electricity, Magnetism, and Electro-teleg-		-
raphy 8vo,	2	50
Electrical Measurement and the Galvanometer12mo,	0	75
Lodge, O. J. Elementary Mechanics 12mo,		50
Signalling Across Space without Wires. 8vo,	*2	00
Loewenstein, L. C., and Crissey, C. P. Centrifugal Pumps.	*4	50
Lomax, J. W. Cotton Spinning	1	50
Lord, R. T. Decorative and Fancy Fabrics . 8vo.	*3	50
Loring, A. E. A Handbook of the Electromagnetic Telegraph,		-
16mo,	0	50
— Handbook. (Science Series No. 39)	0	50
Lovell, D. H. Practical Switchwork. Revised by Strong and Whitney	Dean	ر م
	. 1 ES.	J. /

Low, D. A. Applied Mechanics (Elementary) 16mo, o 80
Lubschez, B. J. Perspective 12mo, *1 50
Lucke, C. E. Gas Engine Design 8vo, *3 00
Power Plants: their Design, Efficiency, and Power Costs.
2 vols (In Preparation.)
Luckiesh, M. Color and Its Application 8vo, *3 00
Light and Shade and Their Applications 8vo, *2 50
The two when purchased together *5 oo
Lunge, G. Coal-tar Ammonia. Three Parts 8vo, *18 00
Manufacture of Sulphuric Acid and Alkali. Four Volumes.
8vo,
Vol. I. Sulphuric Acid. In three parts *18 00
Vol. II. Salt Cake, Hydrochloric Acid and Leblanc Soda.
In two parts
Vol. IV. Electrolytic Methods
— Technical Chemists' Handbook 12mo, leather, *3 50
Technical Methods of Chemical Analysis. Trans. by
C. A. Keane. In collaboration with the corps of
specialists.
Vol. I. In two parts 8vo, *15 oo
Vol. II. In two parts
The set (3 vols.) complete*48 oo
— Technical Gas Analysis
Luquer, L. M. Minerals in Rock Sections 8vo, *1 50
Macaulay, J., and Hall, C. Modern Railway Working,
Macaulay, J., and Hall, C. Modern Railway Working.
Each volume separately 3 00
Macewen, H. A. Food Inspection 8vo, *2 50
Macewen, H. A. Food Inspection 8vo, *2 50  Mackenzie, N. F. Notes on Irrigation Works 8vo, *2 50  Mackie, J. How to Make a Woolen Mill Pay 8vo, *2 00
Mackie, J. How to Make a Woolen Mill Pay 8vo, *2 oo
Maguire, Wm. R. Domestic Sanitary Drainage and Plumbing
8vo, 4 oo
Malcolm, C. W. Textbook on Graphic Statics 8vo, *3 oo

Malcolm, H. W. Submanne Telegraph Cable (In	Pres	:s.)
Mallet, A. Compound Engines. Trans. by R. R. Buel.		
(Science Series No. 10.) 16mo,		
(Science Series No. 10.) 16mo, Mansfield, A. N. Electro-magnets. (Science Series No. 64)		
16шо,	0	50
Marks, E. C. R. Construction of Cranes and Lifting Machinery		_
12m0,	*1	50
Construction and Working of Pumps 12mo,	*1	50
— Manufacture of Iron and Steel Tubes 12mo,	*2	
Mechanical Engineering Materials12mo,	*1	00
Marks, G. C. Hydraulic Power Engineering 8vo,		50
Inventions, Patents and Designs 12mo,		
Marlow, T.G. Drying Machinery and Practice. 8vo,	*5	00
Marsh, C. F. Concise Treatise on Reinforced Concrete 8vo,	*2	50
Marsh, C. F. Reinforced Concrete Compression Member		
Diagram Mounted on Cloth Boards	×ı	50
Marsh, C. F., and Dunn, W. Manual of Reinforced Concrete		
and Concrete Block Construction . 16mo, mor.,	<sup>‡</sup> 2	50
Marshall, W.J., and Sankey, H. R. Gas Engines. (Westminster		
Series.) 8vo,	*2	00
Martin, G. Triumphs and Wonders of Modern Chemistry.	ŧ	
940	*2	00
Modern Chemistry and Its Wonders 8vo,	*2	00
Martin, N. Properties and Design of Reinforced Concrete,		
12m0,		50
Martin, W. D. Hints to Engineers	*1	00
Massie, W. W., and Underhill, C. R. Wireless Telegraphy and		
Telephony	*1	
Mathot, R. E. Internal Combustion Engines8vo,		00
Maurice, W. Electric Blasting Apparatus and Explosives 8vo,	*3	
Shot Firer's Guide 8vo,	*1	50
Maxwell, J. C. Matter and Motion. (Science Series No. 36.)		
16mo,	0	50
Maxwell, W. H., and Brown, J. T. Encyclopedia of Municipal		
and Sanitary Engineering 4to, Mayer, A. M. Lecture Notes on Physics 8vo,	*10	00
Mayer, A. M. Lecture Notes on Physics 8vo,	2	
Mayer, C., and Slippy, I. C. Telephone Line Construction, 8vo.	*2	00

McCullough, E. Practical Surveying 12mo,	*2 00
Engineering work in Cities and Towns 8vo.	*3 00
Reinforced Concrete 12mo,	*1 50
McCullough, R S. Mechanical Theory of Heat 870	3 50
McGibbon, W. C. Indicator Diagrams for Marine Engineers,	- 0
8vo,	*3 00
— Marine Engineers' Drawing Book oblong 4to,	<sup>4</sup> 2 00
Marine Engineers' Pocketbook 12mo, leather,	*4 00
McIntosh, J. G. Technology of Sugar 8vo,	*5 00
Industrial Alcohol	*3 00
Manufacture of Varnishes and Kindred Industries.	
Three Volumes. 8vo.	
Vol. I. Oil Crushing, Refining and Boiling.	*3 50
Vol. II. Varnish Materials and Oil Varnish Making	*4 00
Vol. III. Spirit Varnishes and Materials	*4 50
McKnight, J. D., and Brown, A. W. Marine Multitubular	
Boilers	*1 50
McMaster, J. B. Bridge and Tunnel Centres. (Science Series	
No. 20.)	0 50
McMechen, F. L. Tests for Ores, Minerals and Metals. 12mo,	*I 00
McPherson, J. A. Water-works Distribution 8vo,	2 50
Meade, R. K. Design and Equipment of Small Chemical	
Laboratories	*1 25
Mensch, L. J. Reinforced Concrete Pocket Book 16mo, leather	*4 00
Merck, E. Chemical Reagents: Their Purity and Tests.	4 00
Trans. by H. E. Schenck 8vo,	I 00
Merivale, J. H. Notes and Formulae for Mining Students,	
12m0,	I 50
Merritt, Wm. H. Field Testing for Gold and Silver. 16mo, leather,	I 50
Mierzinski, S. Waterproofing of Fabrics. Trans. by A. Morris	
and H. Robson 8vo,	*2 50
Miessner, B. F. Radiodynamics	*2 00
Miller, G. A. Determinants. (Science Series No. 105.). 16mo,	ale.
Miller, W. J. Historical Geology 12mo,	*2 00
Mills, C. N. Elementary Mechanics for Engineers12mo,	4 I 00
Milroy, M. E. W. Home Lace-making 12mo,	*I 00

## 30 D. VAN NOSTRAND COMPANY'S SHORT-TIFLE CATALOG

Mitchell, C. A. Mineral and Aerated Waters 8vo,	*3	00
and Prideaux, R. M. Fibres Used in Textile and		
Allied Industries 8vo,	*3	00
Mitchell, C. F. and G. A. Building Construction and Draw-		
ing 12m0	ψ.	
Elementary Course, Advanced Course,		
		50
Monckton, C. C. F. Radiotelegraphy. (Westminster Series.)  8vo,	*2	-
•	2	UC
Monteverde, R. D. Vest Pocket Glossary of English-Spanish,	*-	
Spanish-English Technical Terms 64mo, leather,	*1	
Montgomery, J. H. Electric Wiring Specifications16mo,	*1	00
Moore, E. C. S. New Tables for the Complete Solution of		
Ganguillet and Kutter's Formula 8vo,	*5	00
Morecroft, J. H., and Hehre, F. W. Short Course in Electrical	4	_
Testing8vo,	*I	50
Morgan, A. P. Wireless Telegraph Apparatus for Amateurs,		
12mo,	*1	
Moses, A. J. The Characters of Crystals. 8vo,	*2	00
and Parsons, C. L Elements of Mineralogy 8vo,		
Moss, S. A. Elements of Gas Engine Design. (Science		
Series No. 121)	0	50
The Lay-out of Corliss Valve Gears. (Science Series		
No. 119.)16mo,	0	50
Mulford, A. C. Boundaries and Landmarks12mo,	*1	00
Mullin, J. P. Modern Moulding and Pattern-making 12mo,	2	50
Munby, A. E. Chemistry and Physics of Building Materials.		
(Westminster Series.) 8vo,	*2	00
Murphy, J. G. Practical Mining 16mo,		00
Murphy, W. S. Textile Industries, 8 vols		
— (Sold separately.)each,		00
Murray, J. A. Soils and Manures. (Westminster Series.) 8vo,	*2	00
Nasmith, J. The Student's Cotton Spinning 8vo,	3	00
Recent Cotton Mill Construction	2	50
Neave, G. B., and Heilbron, I. M. Identification of Organic		
Compounds 12mo,	*1	25

D. VAN NOSTRAND COMPANY'S SHORT-TITLE CATALOG		31
Neilson, R. M. Aeroplane Patents 8vo,	٤2	00
Nerz, F. Searchlights. Trans. by C. Rodgers 8vo, *		00
Neuberger, H., and Noalhat, H. Technology of Petroleum.		
Trans. by J. G. McIntosh 8vo, *1		00
Newall, J. W. Drawing, Sizing and Cutting Bevel-gears .8vo, Newbiging, T. Handbook for Gas Engineers and Managers,		50
	.0	50
Newell, F. H., and Drayer, C. E. Engineering as a Career.  12mo, cloth,	k -	00
paper,		75
		50
Nipher, F. E. Theory of Magnetic Measurements. 12mo,	1	00
,	_	00
Nolan, H. The Telescope. (Science Series No. 51.) 16mo,	O	50
North, H. B. Laboratory Experiments in General Chemistry 12mo,	×1	00
Nugent, E. Treatise on Optics 12mo,	I	50
O'Connor, H. The Gas Engineer's Pocketbook. 12mo, leather, Ohm, G. S., and Lockwood, T. D. Galvanic Circuit. Trans. by	3	50
William Francis. (Science Series No. 102.) 16mo,	0	50
Olsen, J. C. Textbook of Quantitative Chemical Analysis 8vo,	°3	50
Olsson, A. Motor Control, in Turret Turning and Gun Elevating.		
		50
Ormsby, M. T. M. Surveying		50
, , , , , , , , , , , , , , , , , , , ,	-	00 50
Owen, D. Recent Physical Research	1	50
Pakes, W. C. C., and Nankivell, A. T. The Science of Hygiene.		
8vo, *	*I	75
Palaz, A. Industrial Photometry. Trans. by G. W. Patterson,	,	
		00
		00
Parr, G. D. A. Electrical Engineering Measuring Instruments.	٠	
8vo,	<b>'</b> 3	50
Parry, E. J. Chemistry of Essential Oils and Artificial Per-	-	_
· · · · · · · · · · · · · · · · · · ·		

fumes.....

8vo, \*5 00

Parry, E. J. Foods and Drugs. Two Volumes. 8vo. Vol. I. Chemical and Microscopical Analysis of Food		
and Drugs .	*7	50
Vol. II. Sale of Food and Drugs Acts		00
and Coste, J. H. Chemistry of Pigments 8vo	*4	50
Parry, L. Notes on Alloys 8vo,	*3	00
Metalliferous Wastes 8vo.	*2	oc
	, *2	00
Parry, L. A. Risk and Dangers of Various Occupations 8vo,	*3	00
Parshall, H. F., and Hobart, H. M. Armature Windings 4to,	*7	50
Electric Railway Engineering. 4to,	*10	00
Parsons, J. L. Land Drainage 8vo,	*1	50
Parsons, S. J. Malleable Cast Iron 8vo,	*2	50
Partington, J. R. Higher Mathematics for Chemical Students		
12mo,		00
Textbook of Thermodynamics		00
Passmore, A. C. Technical Terms Used in Architecture 8vo,	*3	50
Patchell, W. H. Electric Power in Mines8vo,	⁴4	00
Paterson, G. W. L. Wiring Calculations . 12mo, ——Electric Mine Signalling Installations		00 50
Patterson, D. The Color Printing of Carpet Yarns 8vo,	*3	50
Color Matching on Textiles 8vo,	*3	00
Textile Color Mixing 8vo,		
Paulding, C. P. Condensation of Steam in Covered and Bare		
Pipes 8vo,		00
Transmission of Heat Through Cold-storage Insulation		
Payne, D. W. Founders' Manual	_ <b>*</b> I	00
Peckham, S. F. Solid Bitumens 8vo,	*5	00
Peddie, R. A. Engineering and Metallurgical Books 12mo,	*1	50
Peirce, B. System of Analytic Mechanics 4to,	10	00
Linnear Associative Algebra 4to,	3	00
Pendred, V. The Railway Locomotive. (Westminster Series.)		
8vo,	*2	00
Perkin, F. M. Practical Method of Inorganic Chemistry 12mo,	*1	00
— and Jaggers, E. M. Elementary Chemistry12mo,	*1	00
Perrine, F. A. C. Conductors for Electrical Distribution 8vo.	* 2	50

D. VAN NOSTRAND COMPANY'S SHORT-TITLE CATALORS	4	33
Petit, G. White Lead and Zinc White Paints 8vo,	* 1	50
Petit, R. How to Build an Aeroplane. Trans. by T. O'B.		
Hubbard, and J. H. Ledeboer 8vo,	* 1	50
Pettit, Lieut. J. S. Graphic Processes. (Science Series No. 76.		
16mo,	٥	50
Philbrick, P. H. Beams and Girders. (Science Series No. 88.)		
16mo,	ٺ	
Phillips, J. Gold Assaying	* 2	
—— Dangerous Goods		50
Phin, J. Seven Follies of Science	* I	25
	-	=0
Logarithms for Beginners 12mo, boards,		50 50
The Slide Rule 12mo, boards,		00
Plattner's Manual of Blowpipe Analysis. Eighth Edition, re-	•	-
vised. Trans. by H. B. Cornwall 8vo,	*4	00
Plympton, G.W. The Aneroid Barometer. (Science Series. 16mo,		50
How to become an Engineer. (Science Series No. 100.)		-
16mo,	0	50
— Van Nostrand's Table Book. (Science Series No. 104) 16mo,	0	50
Pochet, M. L. Steam Injectors. Translated from the French.		
(Science Series No. 29.)	0	50
Pocket Logarithms to Four Places. (Science Series.). 16mo,	0	50
leather,	I	00
Polleyn, F. Dressings and Finishings for Textile Fabrics 8vo,	*3	00
Pope, F. G. Organic Chemistry 12mo,	*2	25
Pope, F. L. Modern Practice of the Electric Telegraph. 8vo,	I	50
Popplewell, W. C. Prevention of Smeke 8vo,	*3	-
Strength of Materials	¥Ι	75
Porritt, B. D. The Chemistry of Rubber. (Chemical Mono-		
graphs, No. 3.)	*о	75
Porter, J. R. Helicopter Flying Machine	*I	25
Potts, H. E. Chemistry of the Rubber Industry. (Outlines of		
Industrial Chemistry.) 8vo,	*2	00
Practical Compounding of Oils, Tallow and Grease 8vo,	*3	50

Pratt, K. Boiler Draught	"*I	25
High Speed Steam Engines8vo,	*2	00
Pray, T., Jr. Twenty Years with the Indicator 8vo,		50
Steam Tables and Engine Constant8vo,		00
Prelini, C. Earth and Rock Excavation8vo,	*3	
Graphical Determination of Earth Slopes 8vo,	*2	
Tunneling. New Edition 8vo,	*3	
— Dredging. A Practical Treatise	*3	00
Prescott, A. B. Organic Analysis 8vo,		00
and Johnson, O. C. Qualitative Chemical Analysis 8vo,	*3	50
and Sullivan, E. C. First Book in Qualitative Chemistry		
12m0,	*1	50
Prideaux, E. B. R. Problems in Physical Chemistry . 8vo,	*2	
Primrose, G. S. C. Zinc. (Metallurgy Series.) (In I	Pres	s.)
Prince, G. T. Flow of Water12mo,	*2	00
Pullen, W. W. F. Application of Graphic Methods to the Design		
of Structures 12mo,	*2	50
Injectors: Theory, Construction and Working. 12mo,	*1	50
Indicator Diagrams 8vo,	*2	50
— Engine Testing8vo,	*4	50
Pulsifer, W. H. Notes for a History of Lead 8vo,	4	00
Putsch, A. Gas and Coal-dust Firing. 8vo,	*3	00
Pynchon, T. R. Introduction to Chemical Physics 8vo,	3	00
The Committee of Warthelm (Committee of Market		
Rafter, G. W. Mechanics of Ventilation. (Science Series No		
33		50
	0	50
Treatment of Septic Sewage. (Science Series No. 118.)	_	50
and Baker, M. N. Sewage Disposal in the United States	U	50
4to,	*6	00
Raikes, H. P. Sewage Disposal Works 8vo,	*4	00
Randau, P. Enamels and Enamelling 8vo,	*4	
Rankine, W. J. M. Applied Mechanics 8vo,	•	00
	-	50
Machinery and Millwork 8vo.		00
The Steam-engine and Other Prime Movers8vo.	•	00
and Bamber, E. F. A Mechanical Textbook 18vo,		50

Ransome, W. R. Freshman Mathematics12m0,	* I	35
Raphael, F. C. Localization of Faults in Electric Light and		
Power Mains8vo,	*3	50
Rasch, E. Electric Arc Phenomena. Trans. by K. Tornberg		
8 <b>v</b> o,	*2	00
Rathbone, R. L. B. Simple Jewellery 8vo,	*2	00
Rateau, A. Flow of Steam through Nozzles and Orifices.		
Trans. by H. B. Brydon 8vo,	* I	50
Rausenberger, F. The Theory of the Recoil of Guns 8vo,	*4	50
Rautenstrauch, W. Notes on the Elements of Machine Design,	•	•
8vo, boards,	*1	50
Rautenstrauch, W., and Williams, J. T. Machine Drafting and		•
Empirical Design.		
Part I. Machine Drafting 8vo,	*1	25
Part II. Empirical Design (In Prepar	ratio	n)
Raymond, E. B. Alternating Current Engineering12mo,		
Rayner, H. Silk Throwing and Waste Silk Spinning . 8vo,		
Recipes for the Color, Paint, Varnish, Oil, Soap and Drysaltery		•
Trades 8vo,	*3	50
Recipes for Flint Glass Making	_	50
Redfern, J. B., and Savin, J. Bells, Telephones. (Installa-	т	J-
tion Manuals Series.) 16mo,	*o	50
Redgrove, H. S. Experimental Mensuration 12mo,		25
Redwood, B. Petroleum. (Science Serres No. 92.)16mo,	0	_
Reed, S. Turbines Applied to Marine Propulsion		00
Reed's Engineers' Handbook 8vo,	-	00
Key to the Nineteenth Edition of Reed's Engineers'		•
Handbook 8vo,	*,	00
Useful Hints to Sez-going Engineers 12mo,	1	50
Reid, E. E. Introduction to Research in Organic Chemistry.	n	
(In 1		5.)
Reid, H. A. Concrete and Reinforced Concrete Construction,		
8vo,	_	
Reinhardt, C. W. Lettering for Draftsmen, Engineers, and		
Students		
The Technic of Machanical Drafting obligate to heards	×-	00

36 D. VAN NOSTRAND COMPANY'S SHORT-TITLE CATALO	)G
Reiser, F. Hardening and Tempering of Steel. Trans. by A.	
Morris and H. Robson 12mo,	*2 50
Reiser, N. Faults in the Manufacture of Woolen Goods. Trans.	- 30
by A. Morris and H. Robson 8vo,	*2 50
- Spinning and Weaving Calculations 8vo,	*5 00
Renwick, W. G. Marble and Marble Working 8vo,	5 00
Reuleaux, F. The Constructor. Trans. by H. H. Suplee 4to,	*4 00
Reuterdahl, A. Theory and Design of Reinforced Concrete	
Arches 8vo,	*2 00
Reynolds, O., and Idell, F. E. Triple Expansion Engines.	
(Science Series No. 99.)	0 50
Rhead, G. F. Simple Structural Woodwork 12mo,	*1 00
Rhodes, H. J. Art of Lithography 8vo,	3 50
Rice, J. M., and Johnson, W. W. A New Method of Obtaining	
the Differential of Functions . 12mo,	0 50
Richards, W. A. Forging of Iron and Steel12mo,	1 50
Richards, W. A., and North, H. B. Manual of Cement Testing,	
12m0,	*I 50
Richardson, J. The Modern Steam Engine 8vo,	*3 50
Richardson, S. S. Magnetism and Electricity 12mo,	*2 00
Rideal, S. Glue and Glue Testing 8vo,	*4 00
Rimmer, E. J. Boiler Explosions, Collapses and Mishaps 8vo,	³
Rings, F. Concrete in Theory and Practice 12mo,	*2 50
Reinforced Concrete Bridges	*5 00
Ripper, W. Course of Instruction in Machine Drawing. folio, Roberts, F. C. Figure of the Earth. (Science Series No. 79.)	*6 00
roberts, F. C. Figure of the Earth. (Science Series No. 79.)	
Roberts, J., Jr. Laboratory Work in Electrical Engineering	0 50
8vo,	*2 00
Robertson, L. S. Water-tube Boilers 8vo,	2 00
Robinson, J. B. Architectural Composition8vo,	*2 50
Robinson, S. W. Practical Treatise on the Teeth of Wheels.	3-
(Science Series No. 24.) 16mo,	0 50
— Railroad Economics. (Science Series No. 59.)16mo,	
- Land Donomics. (Science Series No. 59.) 101110,	0 50

- Wrought Iron Bridge Members. (Science Series No.

60.). ..... 16mo,

0 50

Robson, J. H. Machine Drawing and Sketching 8vo,	'ı	50
	25	00
Rogers, A. A Laboratory Guide of Industrial Chemistry 12mo,	* 1	50
Elements of Industrial Chemistry 12mo,	*2	50
——Industrial Chemistry 8vo,	*5	00
Rogers, F. Magnetism of Iron Vessels. (Science Series No. 30.)		
	0	50
Rohland, P. Colloidal and its Crystalloidal State of Matter.		•
Trans. by W. J. Britland and H. E. Potts . 12mo.	*1	25
Rollins, W. Notes on X-Light	` <sup>*</sup> 5	
Rollinson, C. Alphabets oblong r2mo,	*1	00
Rose, J. The Pattern-makers' Assistant 8vo,	2	50
Key to Engines and Engine-running . 12mo,	2	50
	*2	
	*2	
— Physical Metallurgy, An Introduction to. (Metallurgy		
Series.)	*3	50
Roth, W. A. Physical Chemistry 8vo,	*2	၀၁
Rothery, G C, and Edmonds, H. O. The Modern Laundry.		
2 vols 4to, half leather, *	'I2	00
Rowan, F. J. Practical Physics of the Modern Steam-boiler.8vo,		
and Idell, F. E. Boiler Incrustation and Corrosion.	•	
(Science Series No. 27.) . 16mo,	0	50
(Science Series No. 27.) 16mo, Roxburgh, W. General Foundry Practice. (Westminster		_
Series.) 8vo,	*2	00
Ruhmer, E. Wireless Telephony. Trans. by J. Erskine-		
	*3	50
	*3	
Rutley, F. Elements of Mineralogy 12mo,		
<u></u> ,	-	7.5
Sanford, P. G. Nitro-explosives 8vo,	*1	ሰብ
Saunders, C. H. Handbook of Practical Mechanics r6mo,	Ţ	00
leather,		
Sayers, H. M. Brakes for Tram Cars		
Scheele, C. W. Chemical Essays 8yo,		
Scheithauer, W. Shale Oils and Tars	*3	50
Scherer, R. Casein. Trans. by C. Salter8vo,	*3	00
	_	

## 38 D. VAN NOSTRAND COMPANY'S SHORT-TITLE CATALOG

Schidrowitz, P. Rubber, Its Production and Industrial Uses,		
8vo,	*5	00
Schindler, K. Iron and Steel Construction Works 12mo,	*1	25
Schmall, C. N. First Course in Analytic Geometry, Plane and		•
Solid 12mo, half leather,	*1	75
Schmall, C. N., and Schack, S. M. Elements of Plane Geometry		
12m0,		25
Schmeer, L. Flow of Water 8vo,	*3	00
Schumann, F. A Manual of Heating and Ventilation.		
12mo, leather,		
Schwartz, E. H. L. Causal Geology 8vo,		50
Schweizer, V. Distillation of Resins 8vo,	*3	50
Scott, W. W. Qualitative Analysis. A Laboratory Manual, 8vo,	*1	50
— Technical Methods of Analysis 8vo (In 1		
Scribner, J. M. Engineers' and Mechanics' Companion.		,
16mo, leather,	r	50
Scudder, H. Electrical Conductivity and Ionization Constants	-	5
of Organic Compounds 8vo,	*3	00
Searle, A. B. Modern Brickmaking 8vo,	*5	00
— Cement, Concrete and Bricks 8vo,	*3	00
Searle, G. M. "Sumners' Method." Condensed and Improved.		
(Science Series No. 124.)16mo,		50
Seaton, A. E. Manual of Marine Engineering 8vo,	8	00
Seaton, A. E., and Rounthwaite, H. M. Pocket-book of Marine Engineering	_	<b>50</b>
Seeligmann, T., Torrilhon, G. L., and Falconnet, H. India	3	50
Rubber and Gutta Percha. Trans. by J. G. McIntosh		
870.	*=	00
Seidell, A. Solubilities of Inorganic and Organic Substances, 8vo.	_	00
Seligman, R. Aluminum. (Metallurgy Series)	Pres	·s )
Sellew, W. H. Steel Rails4to,	*12	-
Railway Maintenance Engineering	*2	50
Senter, G. Outlines of Physical Chemistry 12mo,	*1	75
—— Textbook of Inorganic Chemistry 12mo,	*1	75
Sever, G. F. Electric Engineering Experiments . 8vo, boards,	*1	00
trical Engineering 8vo,	*2	50

Sewall, C. H. Wireless Telegraphy 8vo.	*2	00
— Lessons in Telegraphy 12mo,	1	cο
Lessons in Telegraphy 12mo, Sewell, T. The Construction of Dynamos 8vo,	*3	00
Sexton, A. H. Fuel and Refractory Materials 12mo,	* 2	50
Chemistry of the Materials of Engineering 12mo,	*2	50
Alloys (Non-Ferrous)8vo,	*3	00
and Primrose, J. S. G. The Metallurgy of Iron and Steel,		
Some A. W. Jan. David.		50
Seymour, A. Modern Printing Inks 8vo,	*2	00
Shaw, Henry S. H. Mechanical Integrators. (Science Series No. 83.) 16mo,	0	r٦
Shaw, S History of the Staffordshire Potteries 8vo,		
		00
Chemistry of Compounds Used in Porcelain Manufacture.8vo,	_	00
Shaw, W. N. Forecasting Weather 8vo,		50
Sheldon, S., and Hausmann, E. Direct Current Machines 12mo,		50
—— Alternating-current Machines 12m0,		50
Electric Traction and Transmission Engineering12mo,	*2	50
Shields, J. E. Note ion Engineering Construction 12mo,	I	50
Shreve, S. H. Strength of Bridges and Roofs 8vo,	3	50
Shunk, W. F. The Field Engineer 12mo, mor.,	2	50
Simmons, W. H., and Appleton, H. A. Handbook of Soap		
Manufacture 8vo,	*3	00
Simmons, W. H., and Mitchell, C. A. Edible Fats and Oils,		
8vo,		00
Simpson, G. The Naval Constructor. 12mo, mor.,	*5	00
Simpson, W. Foundations	Pre	ss.)
Sinclair, A. Development of the Locomotive Engine.		
8vo, half leather,	5	00
Sindall, R. W. Manufacture of Paper. (Westminster Series.)		
8vo,	*2	00
- and Bacon, W. N. The Testing of Wood Pulp . 8vo,	· *2	50
Sloane, T. O'C. Elementary Electrical Calculations 12mo,	*2	00
Smallwood, J. C. Mechanical Laboratory Methods. (Van	₹ 1	
Nostrand's Textbooks.)	*2	50
Smith, C A. M. Handbook of Pesting, MATERIALS 8vo,		50
- and Warren, A. G. New Steam Tables 8yo,	*1	25
Smith, C. F. Practical Alternating Currents and Testing 8vo,		50
—— Practical Testing of Dynamos and Motors 8vo.		00

Smith, F. A. Railway Curves 12mo,	*1	oc
- Standard Turnouts on American Railroads12mo,	*1	00
- Maintenance of Way Standards	*1	50
Smith, F. E. Handbook of General Instruction for Mechanics.		
, 12mo,		50
Smith, H. G. Minerals and the Microscope12mo,	*1	25
Smith, J. C. Manufacture of Paint8vo,	*3	50
Smith, R. H. Principles of Machine Work12mo,		
- Advanced Machine Work12mo,	*3	00
Smith, W. Chemistry of Hat Manufacturing 12mo,	*3	00
Snell, A. T. Electric Motive Power 8vo,	*4	00
Snow, W. G. Pocketbook of Steam Heating and Ventilation,	-	
(In	Pre	ss.)
Snow, W. G., and Nolan, T. Ventilation of Buildings. (Science		
Series No. 5.)	0	50
Soddy, F. Radioactivity 8vo,	*3	00
Solomon, M. Electric Lamps. (Westminster Series.) 8vo,	*2	00
Somerscales, A. N. Mechanics for Marine Engineers .12mo,	*1	50
Mechanical and Marine Engineering Science8vo,	*5	00
Sothern, J. W. The Marine Steam Turbine 8vo,	*6	ဝ၁
Verbal Notes and Sketches for Marine Engineers 8vo,	*5	00
Sothern, J. W, and Sothern, R. M. Elementary Mathematics		
for Marine Engineers		00
Simple Problems in Marine Engineering Design12mo,	*1	00
Southcombe, J. E. Chemistry of the Oil Industries. (Out-		
· lines of Industrial Chemistry)8vo,	*3	00
Soxhlet, D. H. Dyeing and Staining Marble. Trans. by A.		
Morris and H. Robson 8vo,	*2	50
Spang, H.W. A Practical Treatise on Lightning Protection. 12mo,		00
Spangenburg, L. Fatigue of Metals. Translated by S. H.		
Shreve. (Science Series No. 23.) 16mo,	0	50
Specht, G. J., Hardy, A. S., McMaster, J. B., and Walling. Topo-		
graphical Surveying. (Science Series No. 72.) 16mo,	0	50
Spencer, A. S. Design of Steel-Framed Sheds8vo,	*3	50
Speyers, C. L. Text-book of Physical Chemistry 8vo,	*2	25
Spiegel, L. Chemical Constitution and Physiological Action.		
(Trans. by C Luedeking and A. C. Boylston.).12mo,	*1	25

Sprague, E. H. Hydraulics	ı	25
Stability of Masonry12mo,	I	25
Stahl, A. W. Transmission of Power. (Science Series No. 28.)		
16то,		
and Woods, A. T. Elementary Mechanism12mo,	*2	00
Staley, C., and Pierson, G. S. The Separate System of Sewerage.		
8vo,	*3	00
Standage, H. C. Leatherworkers' Manual. 8vo,	-	50
Sealing Waxes, Wafers, and Other Adhesives 8vo.		00
- Agglutinants of All Kinds for All Purposes12mo,	*3	50
Stanley, H. Practical Applied Physics (In I	res	s.)
Stansbie, J. H. Iron and Steel. (Westminster Series.) 8vo.		00
Steadman, F. M. Unit Photography 12mo,		00
Stecher, G. E. Cork. Its Origin and Industrial Uses. 12mo,	I	00
Steinman, D.B. Suspension Bridges and Cantilevers. (Science		
Series No. 127.)		50
Melan's Steel Arches and Suspension Bridges .8vo,		00
Stevens, H. P. Paper Mill Chemist 16mo.	*2	50
Stevens, J. S. Theory of Measurements		25
Stevenson, J. L. Blast-Furnace Calculations . 12mo, leather,	*2	00
Stewart, G. Modern Steam Traps 12mo,	*1	25
Stiles, A. Tables for Field Engineers 12mo,		00
Stodola, A. Steam Turbines. Trans. by L. C. Loewenstein 8vo,	*5	00
Stone, H. The Timbers of Commerce 8vo,	3	50
Stopes, M. Ancient Plants 8vo,	*2	00
— The Study of Plant Life 8vo,	*2	00
Stumpf, Prof. Una-Flow Steam Engine 4to,	*3	50
Sudborough, J. J., and James, T. C. Practical Organic Chem-		
istry	*2	00
Suffling, E.R. Treatise on the Art of Glass Painting 8vo,	*3	50
Sullivan, T. V., and Underwood, N. Testing and Valuation		
of Building and Engineering Materials(In I	res.	s)
Sur, F. J. S. Oil Prospecting and Extracting8vo,	*1	00
Svenson, C. L. Handbook on Piping(In H		
Swan, K. Patents, Designs and Trade Marks. (Westminster		
Series \ 8vo.	*2	00

42	D.	VAN NOSTRAND	COMPANY'S	SHORT-TITLE	CATALOG
----	----	--------------	-----------	-------------	---------

Swinburne, J., Wordingham, C. H., and Martin, T. C. Electric	
Currents. (Science Series No. 109.) . 16me,	0 50
Swoope, C. W. Lessons in Practical Electricity12mo,	*2 00
Tailfer, L. Bleaching Linen and Cotton Yarn and Fabrics.8vo,	*5 00
Tate, J. S. Surcharged and Different Forms of Retaining-walls.	
(Science Series No. 7.)	
Taylor, F. N. Small Water Supplies 12mo,	
— Masonry in Civil Engineering	
Taylor, T. U. Surveyor's Handbook12mo, leather,	4
Backbone of Perspective 12mo,	
Taylor, W. P. Practical Cement Testing 8vo,	-
Templeton, W. Practical Mechanic's Workshop Companion,	
12m0, morocco,	
Tenney, E. H. Test Methods for Steam Power Plants.	
(Van Nostrand's Textbooks.) 12mo,	*2 50
Terry, H. L. India Rubber and its Manufacture. (West-	
minster Senes.) 8vo,	
Thayer, H. R. Structural Design 8vo,	
Vol. I. Elements of Structural Design	
Vol. II. Design of Simple Structures	
Vol. III. Design of Advanced Structures (In Prepar	
Foundations and Masonry (In Prepar	
Thiess, J. B., and Joy, G. A. Toll Telephone Practice 8vo,	*3 50
Thom, C., and Jones, W. H. Telegraphic Connections.	
oblong 12mo,	
Thomas, C. W. Paper-makers' Handbook (In I	
Thompson, A. B. Oil Fields of Russia 4to,	
Oil Field Development and Petroleum Mining 8vo,	*7 50
Thompson, S. P. Dynamo Electric Machines. (Science	
Series No. 75.) 16mo,	o 50
Thompson, W. P. Handbook of Patent Law of All Countries,	
16m0,	
Thomson, G. Modern Sanitary Engineering 12mo,	
Thomson, G. S. Milk and Cream Testing 12mo,	
Modern Sanitary Engineering, House Drainage, etc 8vo.	*3 00

D. VAN NOSTRAND COMPANY'S SHORT-TITLE CALABOU 4	3
Thornley, T. Cottom Combing Machines	)
— Cotton Waste 8vo, *2 50	)
Cotton Spinning	)
First Year	3.
Second Year	
Third Year *2 5	
Thurso, J. W. Modern Turbine Practice 8vo, *4 o	
Tidy, C. Meymott. Treatment of Sewage. (Science Series	•
No. 94.)	0
Tillmans, J. Water Purification and Sewage Disposal. Trans.	
by Hugh S. Taylor 8v0, *2 0	ю
Tinney, W. H. Gold-mining Machinery 8vo, *3 o	ю
Titherley, A. W. Laboratory Course of Organic Chemistry 8vo, *2 o	
Tizard, H. T. Indicators In Press.	
Toch, M. Chemistry and Technology of Paints 8vo, *4 c	
Materials for Permanent Painting 12mo, *2 c	
Tod, J., and McGibbon, W. C. Marine Engineers' Board of	
Trade Examinations8vo, *1 5	60
Todd, J., and Whall, W. B. Practical Seamanship 8vo, *7 5	
Tonge, J. Coal. (Westminster Series.) 8vo, *2 c	
Townsend, F. Alternating Current Engineering 8vo, boards, *o 7	
Townsend, J. Ionization of Gases by Collision 8vo, *1 2	
Transactions of the American Institute of Chemical Engineers.	, ,
Seven volumes now ready. Vols. I to VIII, 1908-1915,	
8vo, each, *6 c	00
Traverse Tables. (Science Series No. 115.)16mo, o 5	
mor, 1 c	
Treiber, E. Foundry Machinery. Trans. by C. Salter. 12mo, 1 2	
Trinks, W., and Housum, C. Shaft Governors. (Science	
Series No. 122.)	50
Trowbridge, D. C. Handbook for Engineering Draughtsmen.	
(In Press.	.)
Trowbridge, W. P. Turbine Wheels. (Science Series No. 44.)	
16m0, 0.5	50
Tucker, J. H. A Manual of Sugar Analysis 8vo, 3 5	50
Tunner, P. A. Treatise on Roll-turning. Trans. by J. B.	
Pearse 8vo text and folio atlas, 10 c	00

-

D. VAN NOSTRAND COMPANY'S SHORT-TITLE CATALO	)G
Swin all, Jr., J., and Robinson, S. W. A Treatise on the Compound Steam-engine. (Science Series No. 8.)	, , 44"
Swoop' 16mo, .ner, H. Worsted Spinners' Handbook 12mo,	*2 00
Turrill, S. M. Elementary Course in Perspective12mo,	*1 25
Twyford, H. B. Purchasing	*3 00
Tyrrell, H. G. Design and Construction of Mill Buildings 8vo,	*4 00
Concrete Bridges and Culverts16mo, leather,	*3 00
	*3 00
Underhill, C. R. Solenoids, Electromagnets and Electromag-	
netic Windings	*2 00
Underwood, N., and Sullivan, T. V. Chemistry and Tech-	
nology of Printing Inks 8vo,	*3 00
Urquhart, J. W. Electro-plating 12mo,	2 00
Electrotyping	2 00
Usborne, P. O. G. Design of Simple Steel Bridges8vo,	*4 00
Vacher, F. Food Inspector's Handbook 12mo, Van Nostrand's Chemical Annual. Third issue 1913. Leather.	*3 00
12m0,	*2 50
— Year Book of Mechanical Engineering Data (In P	
Van Wagenen, T. F. Manual of Hydraulic Mining 16mo,	I 00
Vega, Baron, Von. Logarithmic Tables 8vo, cloth,	2 00
half mor., Vincent, C. Ammonia and its Compounds. Trans by M. J.	2 50
Salter	*2 00
Volk, C. Haulage and Winding Appliances	*4 00
Von Georgievics, G. Chemical Technology of Textile Fibres.	· 2
Trans. by C. Salter 8vo,	*4 50
Chemistry of Dyestuffs. Trans. by C. Salter 8vo,	*4 50
Vose, G. L. Graphic Method for Solving Certain Questions in	
Arithmetic and Algebra. (Science Series No. 16.)	
•	0 50
Vosmaer, A. Ozone 8vo,	*2 50
Wabner, R. Ventilation in Mines. Trans. by C. Salter .8vo,	*4 50
·	*4 00

D. VAN NOSTRAND COMPANY'S SHORT-TITLE CATALO	G	45
Wadmore, J. M. Elementary Chemical Theory 12mo,	· 1	50
Wadsworth, C. Primary Battery Ignition 12mo,		50
Wagner, E. Preserving Fruits, Vegetables, and Meat. 12mo,		50
Waldram, P. J. Principles of Structural Mechanics. 12mo,		00
Walker, F. Aerial Navigation	•	00
— Dynamo Building. (Science Series No. 98.) . 16mo,	0	50
Walker, J. Organic Chemistry for Students of Medicine 8vo,		50
Walker, S. F. Steam Boilers, Engines and Turbines 8vo,	3	00
Refrigeration, Heating and Ventilation on Shipboard,		
12m0,	*2	
Electricity in Mining 8vo,		50
Wallis-Tayler, A. J. Bearings and Lubrication 8vo,		50
Aerial or Wire Ropeways 8vo,	<b>*</b> 3	
— Sugar Machinery 12m0,	*2	00
Walsh, J. J. Chemistry and Physics of Mining and Mine		
Ventilation	*2	
Wanklyn, J. A. Water Analysis	2	00
Wansbrough, W. D. The A B C of the Differential Calculus,	*-	50
Slide Valves	*2	•
Waring, Jr., G. E. Sanitary Conditions. (Science Series	. 2	oo
No. 31.)	_	50
Sewerage and Land Drainage	*6	-
Modern Methods of Sewage Disposal 12mo,		00
— How to Drain a House		25
Warnes, A. R. Coal Tar Distillation	*2	-
Warren, F. D. Handbook on Reinforced Concrete 12mo,	*2	_
Watkins, A. Photography. (Westminster Series.) 8vo,	*2	-
Watson, E. P. Small Engines and Boilers12mo,		25
Watt, A. Electro-plating and Electro-refining of Metals 8vo,	*4	-
Electro-metallurgy		00
—— The Art of Soap-making	3	00
Leather Manufacture 8vo,	*4	00
Paper Making	3	00
Webb, H. L. Guide to the Testing of Insulated Wires and		
Cables	I	00
	*2	00

46 D	VAN	NOSTRAND	COMPANY'S	SHORT-TITLE	CATALOG
------	-----	----------	-----------	-------------	---------

7	à	
	۸.	
Weisbach, J. A Manual of Theoretical Mechanics 8vo,		100
sheep,		50
and Herrmann, G. Mechanics of Air Machinery. 8vo,	_	75
Wells, M. B. Steel Bridge Designing 8vo,	*2	50
Weston, E. B. Loss of Head Due to Friction of Water in Pipes,		
, 12m0,	*1	50
Wharen, G. B., and Yoder, J. H. Locomotive Valves and		
Valve Gears	res	s)
Wheatley, O. Ornamental Cement Work 8vo,	*2	00
Whipple, S. An Elementary and Practical Treatise on Bridge		
Building 8vo,	3	00
White, C. H. Methods in Metallurgical Analysis. (Van		
Nostrand's Textbooks)	2	50
White, G. F. Qualitative Chemical Analysis 12mo,		25
		25
White, G. T. Toothed Gearing12mo, Wilcox, R. M. Cantilever Bridges. (Science Series No. 25)		Ŭ
16mo,	٥	50
Wilda, H. Steam Turbines. Trans. by C. Salter12mo,		25
— Cranes and Hoists. Trans. by Chas. Salter12mo,		25
Wilkinson, H. D. Submarine Cable Laying and Repairing 8vo,		00
Williamson, J. Surveying		00
Williamson, R. S. On the Use of the Barometer4to,	_	00
— Practical Tables in Meteorology and Hypsometry 4to,	-	50
Wilson, F J., and Heilbron, I. M. Chemical Theory and Cal-	_	J
culations	*,	00
Wilson, J. F. Essentials of Electrical Engineering 8vo,		50
Wimperis, H. E. Internal Combustion Engine8vo,		90
- Application of Power to Road Transport	_	50
— Primer of Internal Combustion Engine 12mo,	*1	00
Vinchell, N. H., and A. N. Elements of Optical Mineralogy .8vo,		50
Vinslow, A. Stadia Surveying. (Science Series No. 77.) .16mo,		50
Visser, Lieut. J. P. Explosive Materials. (Science Series No.	·	J
70.) 16mo,	^	50
Visser, Lieut. J. P. Modern Gun Cotton. (Science Series No.	J	20
80.)	0	50
Wolff, C. E Modern Locomotive Practice8vo,		-
Torn, C. 12 modern bocomotive flactice8v0,	"4	20

Wood, De V. Luminiferous Aether. (Science Series No. 85.)		
16mo,	٥	50
Wood, J. K. Chemistry of Dyeing. (Chemical Monographs		•
No. 2.)	^0	75
Worden, E. C. The Nitrocellulose Industry. Two vols .8vo,		
Technology of Cellulose Esters. In 10 vols8vo.	10	00
Vol. VIII. Cellulose Acetate.	*-	00
Wren, H. Organometallic Compounds of Zinc and Magnesium.	3	Ų.
(Chemical Monographs No. 1.)12mo,	*-	~-
	*0	
Wright, A. C. Analysis of Oils and Allied Substances 8vo,		50
—— Simple Method for Testing Painter's Materials8vo,	*2	_
Wright, F. W. Design of a Condensing Plant12mo,	*1	_
Wright, H. E. Handy Book for Brewers8vo,	*5	00
Wright, J. Testing, Fault Finding, etc. for Wiremen (Installa-		
tion Manuals Series)		50
Wright, T. W. Elements of Mechanics		50
and Hayford, J. F. Adjustment of Observations 8vo,	*3	00
Wynne, W. E., and Spraragen, W. Handbook of Engineering	*	
Mathematics	↑2	00
Young, J. E. Electrical Testing for Telegraph Engineers8vo,	*4	00
Zahner, R. Transmission of Power. (Science Series No. 40.)		
тбто,		
Zeidler, J., and Lustgarten, J. Electric Arc Lamps8vo,	*2	00
Zeuner, A. Technical Thermodynamics. Trans. by J. F.		
Klein. Two Volumes8vo,	*8	00
Zimmer, G. F. Mechanical Handling and Storing of Materials,		
4to,		-
Zipser, J. Textile Raw Materials. Trans. by C. Salter8vo,	*5	00
Zur Nedden, F. Engmeering Workshop Machines and Proc-		
esses. Trans. by J. A. Davenport8vo,	*2	00

## D. VAN NOSTRAND COMPANY

are prepared to supply, either from their complete stock or at short notice,

## Any Technical or Scientific Book

In addition to publishing a very large and varied number of SCIENTIFIC AND ENGINEERING BOOKS, D. Van Nostrand Company have on hand the largest assortment in the United States of such books issued by American and foreign publishers.

All inquiries are cheerfully and carefully answered and complete catalogs sent free on request.

25 PARK PLACE

NEW YORK

Carnegie Institute of Technology
Library
Pittsburgh, Pa.



UNIVERSAL LIBRARY



UNIVERSAL , LIBRARY